

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2013

Published April 3, 2013

CHILD SEATS:

None during March 2013.

EQUIPMENT:

Emerson Process Management Regulatory Technologies, Inc. (Emerson) is recalling certain Fisher-branded H732 and H832 pressure relief valves, manufactured January 2003 through January 2013, used in cargo tank trailers. The stem of the valve may break, resulting in separation. This may result in the valve being ejected and pressurized gas being released into the atmosphere. The ejected valve could strike another vehicle and cause personal injury or a vehicle crash. The release of gas near an ignition source could also lead to a vehicle fire. Emerson will notify owners and replace the valves free of charge. The recall is expected to begin during April 2013. Customers may contact Emerson at 1-888-237-1751.

13E-014

Thermo King is recalling certain T-Series (Model T570R, T600, T600R, T800, T800R, T1000, T1000R, T1000 Spectrum) and V-Series (Model 200, 300, 520) temperature control units, manufactured from January 2009 through February 2013 and equipped with the electric standby option. Water may intrude into the unit through an improperly sized connector/seal. This may cause corrosion near the electrical terminals, resulting in an electrical short circuit. An electrical short circuit may result in a vehicle fire. Thermo King will notify owners, and dealers will replace the existing connector and O-ring with a properly sized connector, new sealing washer and gasket, free of charge. The recall is expected to begin on April 8, 2013. Owners may contact Thermo King at 1-952-887-2200.

13E-015

TIRES:

None during March 2013.

VEHICLES:

Nissan is recalling certain model year 2013 Sentra vehicles manufactured from September 11, 2012, through October 4, 2012. Some fuel tank assemblies were not properly sealed during the manufacturing process. As a result, a small amount of gasoline may leak from the tank when it is full. A gasoline leak in the presence of an ignition source may lead to a vehicle fire. Nissan will notify owners, and dealers will replace the fuel tanks as necessary, free of charge. The recall began on April 1, 2013. Owners may contact Nissan Customer Service at 1-800-647-7261.

13V-068

Nissan is recalling certain model year 2013 Altima, LEAF, Pathfinder, Sentra, and Infiniti JX35 vehicles. Sensors within the passenger Occupant Detection System (ODS) may have been manufactured out of

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2013

Published April 3, 2013

specification. This may cause the system to malfunction and permanently suppress the passenger airbag. If the vehicle is involved in a crash necessitating airbag deployment and the passenger airbag is suppressed, there may be an increased risk of personal injury. Nissan will notify owners, and dealers will inspect the ODS sensors and replace them as necessary, free of charge. The recall is expected to begin in early April 2013. Owners may contact Nissan Customer Service at 1-800-647-7261.

13V-069

Jayco is recalling certain model year 2013 Jay Flight Bungalow, Jay Flight Destination, Jay Flight and Eagle travel trailers; and model year 2013 Eagle and Eagle Premier Fifth-Wheels. The vehicles were manufactured January 24, 2013, through February 27, 2013 and equipped with a power converter supplied by Progressive Dynamics, Inc. The affected power converters, used in recreational vehicles to supply A/C power, have internal components that may short circuit. An electrical short may lead to a vehicle fire. Jayco will notify owners, and dealers will modify the affected power converters free of charge. The safety recall began on March 20, 2013. Owners may contact Jayco at 1-574-825-0608.

13V-070

Starcraft is recalling certain model year 2013 Autumn Ridge and Travel Star travel trailers manufactured January 24, 2013, through February 27, 2013 and equipped with a power converter supplied by Progressive Dynamics, Inc. The affected power converters, used in recreational vehicles to supply A/C power, have internal components that may short circuit. An electrical short may lead to a vehicle fire. Starcraft will notify owners and dealers will modify the affected power converters free of charge. The safety recall began on March 20, 2013. Owners may contact Starcraft at 1-800-945-4787.

13V-071

Caterpillar is recalling certain 2012 and 2014 Caterpillar CT660 heavy duty trucks manufactured by Navistar between October 31, 2011, and January 23, 2013. Certain side marker lamps and/or reflective tape were not applied to these vehicles, which have a length of 30 feet or longer. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 108, "Lamps, Reflective Devices, and Associated Equipment." Missing side marker lamps and/or reflective tape reduces the visibility of the truck to others, which increases the risk of a vehicle crash. Caterpillar will notify owners, and dealers will repair the vehicles free of charge. The recall is expected to begin during April 2013. Owners may contact Caterpillar at 1-800-447-4986.

13V-072

Daimler Trucks North America (DTNA) is recalling certain model year 2011-2013 MT45G and MT55G van chassis manufactured from February 15, 2010, through April 30, 2012. These vehicles have gasoline fuel tanks that may experience cracks in the welds and tank material. Cracks in the fuel tanks could lead to a leakage of gasoline and vapors. A fuel leak in the presence of an ignition source may lead to a vehicle fire. DTNA will notify owners, and dealers will replace any of the affected fuel tanks free of charge. The recall will begin on April 29, 2013. Owners may contact DTNA at 1-800-547-0712. DTNA's recall campaign number is FL-640.

13V-073

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2013

Published April 3, 2013

Daimler Trucks North America (DTNA) is recalling certain model year 2012-2013 Business Class M2, 108SD, 114SD vehicle chassis, manufactured from December 3, 2011, through October 12, 2012 and equipped with a SmartPlex switch hub module. Residue left over in the manufacturing process of the switch hub module may lead to intermittent shorts and energizing of certain switch hub module outputs. If the module is energized, the module may inadvertently activate body equipment or features, increasing the risk of injury to the vehicle operator or increasing the risk of a crash. DTNA will notify owners, and dealers will replace any of the affected modules free of charge. The recall will begin on April 29, 2013. Owners may contact DTNA at 1-800-547-0712. DTNA's recall campaign number is FL-639.

13V-074

Terex South Dakota, Inc. (Terex) is recalling certain model year 2012 utility trucks with SCM Aerial Devices. The lifting device's leveling arm may flex at the elbow and contact the boom structure. This may cause the leveling arm to break. If the leveling arm fails, the platform could tilt and the occupants may fall from the platform. Terex will notify owners, and dealers will replace the leveling arm free of charge. The recall is expected to begin during April 2013. Owners may contact Terex at 1-605-882-4000. Terex's recall campaign number is SN604.

13V-075

Subaru is recalling certain model year 2012 Outback and Legacy vehicles manufactured from April 6, 2011, through May 12, 2011. The moonroof glass may come loose or detach. The amount and position of the adhesive between the glass and retainer was inadequately applied. The moonroof glass can loosen and detach from the vehicle during driving, resulting in a potential road hazard for other vehicles, increasing the risk of a crash. Subaru has notified the affected owners, and dealers will inspect the glass adhesion condition and either apply additional adhesive or replace the moonroof glass, free of charge. The safety recall began February 22, 2013. Owners may contact Subaru at 1-800-782-2783. Subaru's recall campaign number is WWV-33. This is an expansion of NHTSA recall 11V-467.

13V-077

Subaru is recalling certain model year 2012 Outback and Legacy vehicles manufactured from April 6, 2011, through May 12, 2011. Components inside the wiper motor bottom cover may overheat. If the components overheat, the wiper motor bottom cover may melt and potentially catch fire. Subaru has notified all affected owners, and dealers will replace the front wiper motor bottom cover assembly free of charge. The safety recall began February 22, 2013. Owners may contact Subaru at 1-800-782-2783. Subaru's recall campaign number is WVV-32. This is an expansion of NHTSA recall 11V-469.

13V-078

Great Dane Trailers is recalling certain model year 2011 Dry Freight Semi-Trailers. Welds at the bottom of the I-beam bogie frame may have been improperly applied. The cracking and failure of these welds may lead to hanger and axle disengagement. A hanger and axle disengagement from the bogie frame could lead to a loss of control, increasing the risk of a crash. The owner was notified on March 4, 2013, and repairs are well underway. Therefore, an owner notification will not be issued for this campaign. Owners may contact Great

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2013

Published April 3, 2013

Dane customer service at 1-877-369-3493.

13V-079

General Motors is recalling certain model year 2011 Chevrolet Express vehicles converted by Impco Automotive to run compressed natural gas (CNG), manufactured between November 23, 2010, and December 23, 2010, and equipped with a four tank configuration using a pressure relief device (PRD) and pressure relief vent pipe assembly. In the affected vehicles, the pressure relief vent pipe assembly may have been built incorrectly. If a pressure relief device activates with an improperly assembled vent pipe, compressed natural gas may be vented into the passenger compartment. If an ignition source is present, an explosion or fire may result. Impco Automotive, in cooperation with General Motors will inspect and make any necessary repairs on the pressure relief device and vent pipe assembly. The safety recall began on March 28, 2013. Owners may contact General Motors at 1-800-521-7300. This is General Motors campaign number 13065.

13V-080

Ford is recalling certain model year 2004-2007 Freestar and Mercury Monterey vehicles manufactured from March 24, 2003, through November 7, 2006, equipped with a third row seat and originally sold in, or currently registered in, Connecticut, Delaware, Illinois, Indiana, Iowa, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, West Virginia, Wisconsin and the District of Columbia. The third row stowable seat can experience corrosion and structural degradation at the seat anchor mechanism mounted to the rear wheel wells. As a result of the corrosion, the third row seat may not fully latch into its seating position. In the event that the vehicle is crashed into from the rear, an unlatched seat may increase the risk of personal injury. Ford will notify owners, and dealers will install new third row seat latch striker mounting brackets, free of charge. The recall began on March 28, 2013. Owners may contact Ford Motor Company Customer Relationship Center at 1-866-436-7332. Ford's recall campaign number is 13S01.

13V-081

PACCAR is recalling certain model year 2014 Kenworth T270 and T370 trucks, manufactured from January 31, 2013, through February 4, 2013. The left hand seat belt floor pan reinforcement bracket was not positioned correctly during assembly. This could result in the failure of the seat belt anchor mounting. In the event of a crash, the failure in the seat belt anchor may increase the risk of injury. PACCAR will notify owners, and dealers will remove, reposition, and reinstall the reinforcement bracket free of charge. The recall will begin during March 2013. Owners may contact Kenworth at 1-425-828-5000. Kenworth's recall campaign number is 13KWE.

13V-082

Volvo is recalling certain model year 2013 S60 and XC60 vehicles, manufactured on January 7, 2013. The product identification labels were printed with the incorrect manufacture year. Thus, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification Regulation." With an incorrect date of manufacture on the certification label, the vehicle owner may not be able to determine if they are affected by future vehicle recalls, increasing their risk of a crash or injury. Volvo has quarantined the affected vehicles and will install correct labels prior to sale. The recall began during March 2013. Owner notification letters will not be sent.

13V-084

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2013

Published April 3, 2013

Ford is recalling certain model year 2013 Focus and C-Max vehicles built from November 16, 2012, through November 21, 2012; and model year 2013 Escape vehicles manufactured from November 14, 2012, through November 21, 2012. The left rear door child lock was built incorrectly. As a result, the child lock may not engage when the operator uses normal force to activate the child lock. The operator may incorrectly believe the child lock is engaged. However, the door may be opened from the inside, increasing the risk of injury to an unrestrained child. Ford will notify owners, and dealers will inspect the affected rear door latches, and replace them as necessary, free of charge. The recall began on March 27, 2013. Owners may contact Ford Motor Company Customer Relationship Center at 1-866-436-7332. Ford's recall campaign number is 13S02.

13V-085

Terex South Dakota, Inc. (Terex) is recalling certain model year 2012 T292, TL, and NT Aerial Devices installed on utility trucks and equipped with a 110 VAC inverters. The Ground Fault Interrupt (GFI) may not offer GFI protection due to the neutral wire being ungrounded in the inverter. If the GFI does not function, and a tool that is plugged into the inverter has a short, the operator could receive an electrical shock, resulting in electrocution. Terex will notify owners, and dealers will add a jumper wire between the neutral and ground wire, free of charge. The recall is expected to begin in March 2013. Owners may contact Terex at 1-605-882-4000. Terex's recall campaign number is SN605.

13V-088

Terex South Dakota, Inc. (Terex) is recalling certain model year 1999-2012 XL4000 Digger Derrick utility trucks. The shims and spacer used to adjust the length of the hydraulic cylinder may give, causing the rod eye and threads to fatigue while lifting loads. The hydraulic cylinder may separate from the digger derrick arm, allowing it to collapse without warning, increasing the risk of injury to the operator or those nearby. Terex will notify owners, and dealers will inspect and replace the rod eye and threads, as necessary. The existing shims and spacer will be replaced with a hardened spacer. All repairs will be made at no charge to the owner. The manufacturer has not yet provided a notification schedule. Owners may contact Terex at 1-605-882-4000. Terex's recall campaign number is SN602.

13V-089

Crossroads RV (Crossroads) is recalling certain model year 2013 Redwood, Rushmore, and Elevation trailers manufactured January 17, 2013, through February 19, 2013. The trailers are equipped with power converters that supply A/C power. These converters have internal components that may short circuit. A short circuit may lead to a vehicle fire. Crossroads will notify owners, and dealers will replace the affected internal components, free of charge. The recall began on March 21, 2013. Customers may contact Crossroads customer service at 1-855-226-7496 or by email at service@crossroadsrv.com.

13V-090

PACCAR is recalling certain model year 2013-2014 Kenworth T680 and T880 trucks and model year 2013-2014 Peterbilt 567, 579 and 587 trucks equipped with air ride seats. The cables for anchoring the seat belt buckles of both the driver and passenger seat may fray. In the event of a crash, a frayed seat belt could cause the belt to separate from the seat, increasing the risk of injury to the seat occupant. PACCAR will notify owners, and dealers will replace both seat belt buckle assemblies, free of charge. The recall is expected to begin in April

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING MARCH 2013

Published April 3, 2013

2013. Owners may contact Kenworth at 1-425-828-5000 or Peterbilt at 1-940-591-4000. Kenworth's recall campaign number is 13KWD.

13V-091

Honda is recalling certain model year 2005 Pilot vehicles manufactured July 29, 2004, through August 29, 2005; model year 2005-2006 Acura MDX vehicles manufactured September 16, 2004, through September 22, 2005; and model year 2005 Acura RL vehicles manufactured March 1, 2004, through June 29, 2005. An electrical capacitor may have been damaged during the manufacturing of the Vehicle Stability Assist (VSA) control module causing intermittent, automatic, minor brake application. However, if the driver applies the brakes while the VSA is malfunctioning, the vehicle may come to an abrupt stop. Additionally, due to a loose ground connection, certain model year 2005 Pilots have a VSA system that may apply partial brake force, without the illumination of the brake lights, whether or not the driver is using the brakes. Sudden inadvertent braking, especially without illumination of the brake lights, may increase the risk of a vehicle crash. Owners will be notified and instructed to take their vehicles to a dealer of their respective brand. The dealer will install a partial wiring harness containing a capacitor for the VSA modulator, free of charge. The affected model year 2005 Pilots will have their ground connection tightened. The recall is expected to begin on, or about, April 12, 2013. Honda owners may contact Honda Automobile Customer Service at 1-800-999-1009, and select option 4 or go to www.recalls.honda.com; Acura owners may contact 1-800-382-2238, and select option 4, or go to www.recalls.acura.com. Honda's recall campaign numbers are S87, S88, and S89.

13V-092

Honda is recalling certain model year 2004-2008 Acura TSX vehicles originally sold in, or currently registered in, Connecticut, Delaware, Illinois, Indiana, Iowa, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, Wisconsin and the District of Columbia. In states that use corrosive materials for deicing, driver's footwear may bring in materials that saturate the vehicle's carpeting, which is in contact with the vehicle's engine Electronic Control Unit (ECU). As a result, the ECU case may experience rust or corrosion. This damage may potentially cause the engine to stall. A vehicle stall increases the risk of a crash. Honda will notify owners and Acura dealers will inspect the vehicle and replace any damaged ECU, free of charge. All vehicles will have a waterproof cover installed onto the ECU, free of charge. The recall is expected to begin on April 11, 2013. Owners may contact Acura Client Relations at 1-800-382-2238 and select option 4 or go to www.recalls.acura.com. Honda's recall campaign numbers are S86.

13V-093

Nissan is recalling certain model year 2013 Titan trucks manufactured from January 22, 2013, through February 20, 2013; and model year 2013 NV vehicles manufactured from December 17, 2012, through February 20, 2013 and equipped with steering column-mounted transmission shift levers. Chemicals used in the manufacturing of the shift lever assembly may result in the malfunction of the brake shift interlock allowing the transmission shift lever to be shifted out of Park without depressing the brake pedal. If the vehicle is unintentionally shifted out of park, it could roll away and lead to personal injury or a vehicle crash. Nissan will notify owners, and dealers will remedy the vehicles, free of charge. The recall is expected to begin April 8, 2013. Owners may contact Nissan Customer Service at 1-800-647-7261.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2013

Published April 3, 2013

13V-094

Nissan is recalling certain model year 2012-2013 NV vehicles manufactured from December 20, 2010, through January 4, 2013 and are equipped with steering column-mounted transmission shift levers. The transmission lever gear selector plate lock clip may have been installed incorrectly. As a result, normal road vibration may cause the gear position indicator to not match the gear shift lever position. As a consequence of the incorrect display, although the gear indicator may display that the vehicle is in Park, the vehicle may not be properly secured allowing the vehicle to roll away unexpectedly, increasing the risk of personal injury or a vehicle crash. Nissan will notify owners, and dealers will correct the installation of the transmission lever gear selector plate lock clip, free of charge. The recall is expected to begin on April 8, 2013. Owners may contact Nissan Customer Service at 1-800-647-7261.

13V-095

Terex will notify owners, and dealers will reconfigure the hydraulic plumbing and add a solenoid, free of charge. The manufacturer will start notifying owners in April. Owners may contact Terex at 1-605-884-3892. Unexpected movement of the Aerial Device while in use may lead to personal injury. Terex will notify owners, and dealers will reconfigure the hydraulic plumbing and add a solenoid, free of charge. The manufacturer will start notifying owners in April 2013. Owners may contact Terex at 1-605-884-3892. Terex's recall campaign number is SN601.

13V-096

General Motors (GM) is recalling certain model year 2013 Buick LaCrosse vehicles, manufactured between April 25, 2012, through March 6, 2013, and model year 2013 Cadillac SRX vehicles, manufactured between May 29, 2012, through February 18, 2013 for failing to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 102, "Transmission Shift Lever Sequence, Starter Interlock, and Transmission Braking Effect." A software problem may cause the transmission to inadvertently shift to Sport mode removing any transmission-related engine braking effect. If engine braking is unexpectedly removed, it may increase the risk of a vehicle crash. GM will notify owners, and dealers will reprogram the transmission control module free of charge. The recall began on April 3, 2013. Cadillac owners may call 1-866-982-2339. Buick owners may call 1-866-694-6546. General Motors' number for this recall is 13053.

13V-097

Toyota is recalling certain model year 2007 through 2013 FJ Cruiser passenger vehicles. The retractors for the front driver and passenger seat belts are mounted in the access door (rear door) panels of the vehicle. Due to insufficient strength of the access door panel, cracks may develop in the panel if the access door is repeatedly and forcefully closed over an extended period of time. If cracks occur in the panel around the lower retractor anchor, the seat belt retractor could become detached, which could increase the risk of injury to an occupant in the event of a crash. Toyota is currently developing a remedy. Toyota has not yet provided a notification schedule. Owners may contact Toyota at 1-800-331-4331.

13V-098

Daimler Trucks North America (DTNA) is recalling certain model year 2013-2014 Freightliner Cascadia

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2013

Published April 3, 2013

tractors manufactured from May 7, 2012, through March 2, 2013 and equipped with a SAMCAB software version 6.2. On vehicles configured to have the turn signals operate as Daytime Running Lights (DRLs) and the 'Turn-Tip' turn signal function activated, the DRLs may not illuminate properly after using the 'Turn-Tip' function while driving. Failure of the DRLs to illuminate reduces visibility to other drivers and increases the risk of a vehicle crash. The remedy for this recall campaign is still under development. The recall is expected to begin by May 15, 2013. Owners may contact DTNA at 1-800-547-0712. DTNA's recall campaign number is FL-641.

13V-099

Starcraft Bus is recalling certain model year 2004-2009 XLT buses manufactured from January 16, 2004, to October 29, 2009. The affected vehicles have incorrect values for the Gross Vehicle Weight Rating and Gross Axle Weight Rating specified on the certification label. Thus, these vehicles fail to comply with the requirements of 49 CFR Part 567, "Certification." A misprinted label could lead to improper vehicle loading. Improper loading could result in a tire failure, increasing the risk of a crash. Starcraft will notify owners, and dealers will remedy the buses by either providing a new certification label, adding additional suspension and upgrading the rear tires, or removing seats. The safety recall is expected to begin during April 2013. Owners may contact Starcraft Bus at 1-800-348-7440.

13V-100

Navistar is recalling certain model year 2013 International ProStar commercial trucks, manufactured from January 24, 2012, through January 2, 2013, with feature codes 29AEB and 29AEC (Preset Plus hubs). The axle bearing retaining nut lock snap ring may have not been installed or may have been installed incorrectly which may result in the retainer nut working loose and possibly separating the wheel hub from the axle. Separation of a wheel hub from an axle may increase the risk of a crash. Navistar will notify owners, and dealers will inspect and replace any missing axle bearing retainer nut lock snap rings, free of charge. The safety recall is expected to begin by April 19, 2013. Owners may contact Navistar at 1-800-448-7825. Navistar's recall campaign number is 13504.

13V-101

Volvo is recalling certain model year 2012-2014 VHD, VNL, and VNM trucks, manufactured from April 18, 2011, through March 14, 2013, and equipped with a horizontally mounted remote battery disconnect switch. The remote battery disconnect switch was manufactured with incorrect hardware allowing the cables to loosen. Additionally, as mounted, the cables may vibrate and chafe. Loose or chafed cables may lead to overheating of the battery cable and switch which may result in a fire. Volvo will send owners an interim letter and dealers will replace and relocate the remote battery disconnect switch. A second notice will be mailed when parts are become available. Owners may contact Volvo's recall support line at 1-877-800-4945 and select option 1. Volvo's recall campaign number is RVXX1301.

13V-102

Chrysler is recalling certain model year 2013 Dodge Challenger vehicles manufactured from December 3, 2012, through January 24, 2013 and equipped with a V6 engine. The battery positive cable at the starter motor may experience an electrical short circuit to ground. A short circuit could lead to a vehicle fire. Chrysler has begun notifying owners and they are being advised to immediately refrain from driving their vehicles and to contact their

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2013

Published April 3, 2013

dealers. Chrysler Group further advises affected owners not to park their vehicles in, or near, any structures. Dealers will replace the under hood starter cable assembly, free of charge. The recall notification began on March 20, 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N18.

13V-103

Triumph Motorcycles (Triumph) is recalling certain model year 2012-2013 Daytona 675, Street Triple, Speed Triple, and Tiger 800 motorcycles. Due to a manufacturing error, the turn signal stems on the front and rear of the motorcycle may fracture. If the turn signal stems break, the turn signals may not be visible to other vehicles on the road, increasing the risk of a vehicle crash. Triumph will notify owners and dealers will replace the turn signal stems, free of charge. The recall is expected to begin during April 2013. Owners may contact Triumph at 1-678-854-2010 for more information.

13V-104

General Motors is recalling certain model year 2013 Buick Encore vehicles manufactured between December 9, 2012 and December 28, 2012, and equipped with a heated steering wheel. The steering wheel fastener may not have been properly installed. This could cause the steering wheel to come loose or separate from the steering column. If the steering wheel separates from the steering column while driving, the ability to steer could be lost, increasing the risk of a crash. General Motors will notify owners, and dealers will inspect and make any necessary repairs on the steering wheel. These services will be provided at no charge to the customer. The safety recall is expected to begin by April 12, 2013. Owners may contact General Motors at 1-800-521-7300. This is General Motors campaign number 13098.

13V-105

Braun is recalling certain model year 2008-2013 Vision Rear Entry mobility conversion vehicles built on Dodge and Chrysler minivan chassis from December 20, 2012, through March 21, 2013. The track bar mount assemblies were not properly welded during manufacturing. One or more welds are missing from the track bar which could result in separation from the rear axle. If the track bar separates from the rear axle, the track bar may drag the ground and unexpectedly alter the control of the vehicle, increasing the risk of a crash. Braun will notify owners, and Braun dealers will either repair or replace the entire track bar mounting assembly, free of charge. The recall is expected to begin in early April 2013. Owners may contact Braun customer service center at 1-800-488-0359.

13V-106

Hitch-Hiker Mfg., Inc. (Hitch Hiker) is recalling certain model year 2008-2011 food concession trailers equipped with GKN brand axles. In the affected trailers, the axle may break allowing the arm, spindle, hub, wheel and tire to separate. If the trailer is being towed and the axle breaks it may increase the risk of a crash. Hitch-Hiker will notify owners and replace the axles. The recall is scheduled to begin in April 2013. Owners may contact Hitch-Hiker at 1-330-542-3052.

13V-107

North American Bus Industries Inc. (NABI) is recalling certain model year 2012-2013 40LFW transit buses

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2013

Published April 3, 2013

manufactured November 10, 2012, through March 10, 2013, and equipped with adjustable brake and throttle pedals. The brake pedals may not fully release after the brakes are applied. If pressure remains applied to the brakes, they may overheat while driving, which may result in a fire. NABI will notify owners and will inspect and repair the buses free of charge. The recall is expected to begin in April 2013. NABI's recall campaign number is 20132. Owners may contact NABI at 1-256-831-4296.

13V-108

Ford is recalling certain model year 2012 Taurus, Lincoln MKS, and model year 2013 Explorer vehicles manufactured July 19, 2011, through March 15, 2012. In the affected vehicles, the fuel tanks may have a marginally sealed seam in the side of the tank. As a result, the fuel tanks may not provide the expected strength in the event of an impact. The tanks may also leak. A fuel leak in the presence of an ignition source may result in a fire. Ford will notify owners, and dealers will inspect the fuel tanks and replace them as necessary, free of charge. The recall is expected to begin April 22, 2013. Ford's recall campaign number is 13S03. Owners may contact Ford Motor Company Customer Relationship Center at 1-866-436-7332.

13V-109

Subaru is recalling certain model year 2005-2009 Outback and Legacy vehicles manufactured from December 2003, through April 2009 and currently, or formerly, registered in, Connecticut, Delaware, Illinois, Indiana, Iowa, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, West Virginia, Wisconsin and the District of Columbia. Salt water could splash on the brake lines through a gap in the fuel tank protector, resulting in excessive corrosion of the brake lines. Brake line corrosion may result in brake fluid leakage. Fluid leakage may result in longer distances being required to slow or stop the vehicle, increasing the risk of a crash. Subaru will notify owners, and dealers will inspect the vehicles. If no brake fluid seepage is observed, the affected area will be rustproofed with anti-corrosion wax. If brake fluid seepage is observed, the brake lines will be replaced followed by rustproofing with anti-corrosion wax. These services will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru at 1-800-782-2783. Subaru's recall campaign number is WQG-43.

13V-110

Temsa Global is recalling certain model year 2013 TS35C motorcoach buses manufactured between January 2013 and February 2013 and equipped without a key on the steering column. If the steering locks unexpectedly, it would hinder the driver's ability to turn, increasing the risk of a crash. A component within the steering column may cause the steering wheel to lock. Temsa Global will notify owners, and dealers will remedy the affected buses, free of charge. The recall is expected to begin in April 2013. Owners may contact Temsa at 1-404-602-0151.

13V-111

Mitsubishi Motors North America, Inc. (Mitsubishi) is recalling certain model year 2013 Outlander Sport AWD vehicles manufactured June 11, 2012, through December 11, 2012. These vehicles may have been built without a fuel sending unit harness for the sub-sending unit. This may result in a false fuel tank level reading. The vehicle operator may believe they have fuel when the tank is actually empty. This could cause the engine to stall while

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MARCH 2013

Published April 3, 2013

driving, increasing the risk of a crash. Mitsubishi will notify owners, and dealers will install the proper fuel sending harness, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Mitsubishi at 1-888-648-7820. Mitsubishi's campaign recall number is SR-13-005.

13V-112

Mitsubishi Motors North America, Inc. (Mitsubishi) is recalling certain model year 2013 Outlander Sport vehicles manufactured June 11, 2012, through September 11, 2012. These vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment," and FMVSS number 114, "Theft Protection." The brake stop lamps may illuminate continuously or intermittently. The shift lever could also be moved out of Park without depressing the brake pedal. If the brake lamps do not illuminate properly other vehicles may not know when the vehicle is stopping. This could increase the risk of a crash. If the shift lever is moved from park without using the brake, the vehicle may roll causing personal injury. Mitsubishi will notify owners, and dealers will correct the installation of the stop lamp switch, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Mitsubishi at 1-888-648-7820. Mitsubishi's campaign recall number is SR-13-004.

13V-116