

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING APRIL 2013

Published May 7, 2013

CHILD SEATS:

None during April 2013.

EQUIPMENT:

Sika Corporation USA (Sika) is recalling certain SikaTITAN P2G automotive glass bonding adhesives for use on aftermarket automotive glass components. The affected adhesives may not sufficiently harden or cure. As a result, the glass may not be fully secured to the vehicle. If the glass is not properly bonded to the vehicle, the glass may be displaced or fall out increasing the risk of injury to vehicle occupants, property damage, or a vehicle crash. Sika will notify owners and inspect the vehicles. As necessary, the affected auto glass will be reinstalled with new adhesive product free of charge. The recall began on April 9, 2013. Customers may contact Sika at 1-248-307-2543 or 1-248-577-1074.

13E-016

Takata has determined that the inflators in certain frontal passenger-side air bag inflators it manufactured and supplied to various vehicle manufacturers may produce excessive internal pressure causing the inflators to rupture upon deployment of the air bag. In the event of a crash resulting in a necessitating deployment of the passenger's air bag, the inflator could rupture, with metal fragments striking and potentially seriously injuring the passenger seat occupant or other occupants. Owners of all vehicles on which a defective air bag may have been installed either as original equipment, or as a replacement, will be notified by their respective vehicle manufacturers. Dealers will inspect vehicles, and where a defective air bag inflator is identified, the inflator will be replaced, free of charge. Owners may contact their vehicle manufacturer for more information.

13E-017

Schneider Electric is recalling certain EVlink electric vehicle charging stations manufactured from December 6, 2012, to March 17, 2013. The affected models are EV230PDRACG, EV230PDRACNG, EV230PDRACGC, EV230PSRACG, EV230PSRACNG, EV230PSRACGC, EV230WDRACG, EV230WDRACNG, EV230WS, EV230PDR, EV230PDRR, EV230PSR, EV230PSRR, EV230WSR, and EV230WSRR. In these units, the electric vehicle charging station's charger plug pin connectors may overheat, subsequently melting the thermoplastic casing around the pin connectors. In some cases, the generated heat is sufficient enough to cause damage to the car inlet, and/or damage to the charging station plug. This condition also may present a danger of burn if the user has direct contact with the overheated portion of the casing. Schneider Electric will notify owners and a Schneider Electric representative or trained electrical contractor will install a new cord-set free of charge. Owner notification began during April 2013. Owners may contact Schneider Electric at 1-877-283-7647.

13E-018

Dometic is recalling certain WeatherPro motor powered awning models 805, 815, 825, 835, 845, 885, 855, and 905: 9100 Power awning models 910, 912, 913, 914, 915, 916, 917, and 91; and certain awning motor service kits with part numbers starting with 3307923 and 3310423. The serial number range for the WeatherPro and 9100 motor powered awnings is 306XXXXX thru 314XXXXX. These motor powered awnings were either sold in the aftermarket as replacement equipment or installed as original equipment on various recreation

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2013

Published May 7, 2013

vehicles and horse trailers. The awning motor service kits were sold in the aftermarket as service parts for product already installed on recreation vehicles or horse trailers and do not carry an individual serial number. The awning motor service kit must be located by the part number shown above. The motor powered awnings and awning motor service kits were manufactured between February 13, 2013 and April 9, 2013. If the awning or service part installation sequence is not completely followed, the awning motor may unknowingly become damaged. If motor damage occurs, it is possible that the awning can unfurl unexpectedly, either while the coach is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Dometic will send notices to purchasers of the replacement awnings and will work with the vehicle manufacturers to identify and notify owners of the coaches that had the affected awnings installed on their recreational vehicles. Dometic staff will replace the affected motors with a design that is not subject to an out-of-sequence installation error. The recall has already begun. Owners should contact their RV manufacturer or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13E-019

C. E. White is recalling certain Flip Seat model Quasi Static "QSJ11" (30", 36", 39" and 45"), Flip Seat model Student Safety Seat "SSSJ" (30", 36", 39" and 45"), and Flip Seat model School Bus Seat "SBJ" (30", 36", 39" and 45") shipped between the dates of September 12, 2005, and January 31, 2013, to various school bus manufacturers to be installed as original equipment. When a Flip Seat is installed in front of another passenger seat, it is possible for the occupant of the rearward passenger seat to insert their toes and/or foot into the lower frame area of the Flip Seat. When a vehicle passenger occupies the Flip Seat, pushing the seat bottom downward to the horizontal position to sit in the seat, the occupant of the rearward seat could suffer a pinch point injury to their toes and/or foot. C. E. White will work closely with the school bus manufacturers to identify and notify the school bus owners of the safety recall. The school bus manufacturers will install a safety guard to cover the gap in the lower frame of the flip seat. A notification schedule for this campaign has not yet been established. Owners should contact their vehicle manufacturer or C. E. White at 1-419-492-2157 for more information.

13E-020

Cequent Performance Products, Inc. (Cequent) is recalling certain Pro Series Translite Bike Racks, Part No. 63144, manufactured from October 1, 2011 through June 30, 2012. The bike rack cradles may tear if excessive force is applied to the cradle straps. Torn cradles could allow a bike to disengage from the carrier. If a bike disengages from the carrier it may fall onto the roadway, creating a hazard for other vehicles and increasing the risk of a crash. Cequent will replace the dealer inventory and customers will receive a repair kit free of charge. The manufacturer has not yet provided a notification schedule. Customers may contact Cequent at 1-800-931-6689.

13E-021

Prevost Cars, Inc. (Prevost) is recalling certain MGM Type 24-J series piston parking brake chambers sold as service replacement parts. The affected brake chambers may leak air pressure allowing the parking brake to drag when it is supposed to be released. Brake dragging could lead to overheated brake components. Overheated brake components could result in a fire. Prevost will notify owners and dealers will inspect, and replace the brake chambers, as necessary, free of charge. The recall is expected to begin by the end of June 2013. Owners may contact Prevost at 1-418-883-2888 x 6558. Prevost's campaign recall number is SR13-

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING APRIL 2013

Published May 7, 2013

31.

13E-022

TIRES:

Federal Corporation is recalling certain Couragia A/T tires, size P265/75R16 116S, DOT Serial Numbers UX77 3210-UX770813. In the affected tires, excessive heat causes tread shoulder chunking. Thus, these tires fail to conform to the durability test requirements of Federal Motor Vehicle Safety Standard No. 139, "New Pneumatic Radial Tires for Light Vehicles." Tire shoulder tread chunking could cause a tire failure and increase the risk of a crash. Federal Corporation will notify owners and will replace the tires, free of charge. The recall began on April 30, 2013. Owners may contact Federal Tires consumer hotline at 1-855-444-8250.

13T-003

Kumho Tire U.S.A., Inc. (Kumho) is recalling certain Kumho Solus KH25 passenger car tires, size 225/45R17, produced in the weeks of 3411 through 2512 (August 21, 2011 through June 23, 2012). The affected tires could develop cracking in the sidewall, which could result in air loss. Rapid air loss while the vehicle is in use may result in a tire failure that could cause a crash. Kumho will notify owners by mail, instructing them how to return the tires and receive reimbursement. The safety recall is expected to begin during May 2013. Owners may contact Kumho at 1-909-428-3999.

13T-004

VEHICLES:

Hyundai Motor Company (Hyundai) is recalling certain model year 2007-2009 Accent and Tucson, model year 2007-2010 Elantra, model year 2007-2011 Santa Fe, model year 2008-2009 Veracruz, model year 2010-2011 Genesis Coupe, and model year 2011 Sonata vehicles. The stop lamp switch in the affected vehicles may malfunction. A malfunctioning stop lamp switch may cause the brake lights to not illuminate when the brake pedal is depressed or may cause an inability to deactivate the cruise control by depressing the brake pedal. Additionally, a malfunctioning stop lamp switch may also result in intermittent operation of the push-button start feature, affect the operation of the brake-transmission shift interlock feature, preventing the shifter from being moved out of the PARK position and cause the Electronic Stability Control (ESC) malfunction light to illuminate. Failure to illuminate the stop lamps during braking or inability to disengage the cruise control could increase the risk of a crash. Additionally, when the ignition is in the 'ON' position, the transmission shifter may be able to be moved out of Park without first applying the brake. This may lead to unintentional movement of the car which may increase the risk of a crash. Hyundai will notify owners, and dealers will replace the stop lamp switch, free of charge. The safety recall began on April 22, 2013. Owners may contact Hyundai at 1-800-633-5151. Hyundai's recall campaign number is 110.

13V-113

Kia Motors Corporation (Kia) is recalling certain model year 2007-2010 Rondo and Sportage, model year 2007-2011 Sorento, model year 2007 Sedona, model year 2010-2011 Soul, and model year 2011 Optima

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING APRIL 2013

Published May 7, 2013

vehicles. The stop lamp switch in the affected vehicles may malfunction. A malfunctioning stop lamp switch may cause the brake lights to not illuminate when the brake pedal is depressed or may cause an inability to deactivate the cruise control by depressing the brake pedal. Additionally, a malfunctioning stop lamp switch may also result in intermittent operation of the push-button start feature, affect the operation of the brake-transmission shift interlock feature preventing the shifter from being moved out of the PARK position and causing the Electronic Stability Control (ESC) malfunction light to illuminate. Failure to illuminate the stop lamps during braking or inability to disengage the cruise control could increase the risk of a crash. Additionally, when the ignition is in the 'ON' position, the transmission shifter may be able to be moved out of PARK without first applying the brake. This may lead to unintentional movement of the car which may increase the risk of a crash. Kia will send an interim notification to owners in May 2013. When parts are available, owners will receive a second notification and dealers will replace the stop lamp switch, free of charge. Owners may contact Kia at 1-800-333-4542. Kia's recall campaign number is SC098.

13V-114

Hyundai Motor Company is recalling certain model year 2011-2013 Elantra vehicles. A support bracket attached to the headliner may become displaced during a side curtain airbag deployment. If the headliner support bracket makes contact with an occupant during a crash, it may cause a laceration injury. Hyundai will notify owners, and dealers will apply adhesive strips to the headliner, free of charge. The safety will begin on, or about, May 5, 2013. Owners may contact Hyundai at 1-800-633-5151. Hyundai's recall campaign number is 109.

13V-115

Jerr-Dan Corporation is recalling certain model year 2010-2012 Standard Duty Wrecker vehicles manufactured October 4, 2010, through March 1, 2012. The affected vehicles are built on a Ford Super Duty Chassis and equipped with the 6.2L Triton Gasoline engine fitted with a Muncie Power Products clutch pump power take off (PTO). To install the PTO, the Anti-Lock Brake System (ABS) module was relocated. In its new location, a brake hose from the ABS module may chafe against other components. Brake line chafing may lead a loss of brake pressure resulting in additional distances being required to stop the vehicle, increasing the risk of a crash. The remedy for this recall campaign is still under development. A notification schedule has not yet been provided. Owners may contact Jerr-Dan at 1-800-923-9666.

13V-117

Chrysler Group LLC (Chrysler) is recalling certain model year 2011-2012 Chrysler 300, Dodge Challenger, and Dodge Charger vehicles manufactured April 11, 2011, through December 14, 2011. The affected vehicles may have improperly sized terminal crimps on the seat side-airbag wiring harness which may cause the seat side-airbags to malfunction and illuminate the airbag warning light. In the event of a crash necessitating airbag deployment the airbags may not operate as designed, increasing the risk of injury. Chrysler will notify owners, and dealers will replace both driver and passenger seat airbag wiring harnesses, free of charge. The recall began on April 22, 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N07.

13V-118

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2013

Published May 7, 2013

Vactor Manufacturing (Vactor) is recalling certain model year 2012-2013 HXX and Guzzler vacuum trucks equipped with an Alkota water heater. These trucks were not equipped with an oil primary control. If the burner for the water heater fails to ignite normally, fuel can accumulate in the water heater combustion chamber. If fuel accumulates, when the burner is lit, there may be a larger than normal flame which could lead to a vehicle fire. Vactor will notify owners, and dealers will replace the burner assembly, free of charge. The recall began during April 2013. Customers may contact Vactor at 1-815-672-3171. Vactor's recall number is SB-263.

13V-119

Chrysler Group LLC (Chrysler) is recalling certain model year 2012 Jeep Patriot and Compass vehicles manufactured October 18, 2011, through May 7, 2012. Due to an incorrectly manufactured transfer tube, the transfer of fuel from the secondary side to the primary side of the fuel tank may be interrupted, causing the engine to stall. If the engine stalls while driving it may increase the risk of a crash. Chrysler will notify owners, and dealers will replace the fuel tank transfer tube free of charge. The recall is expected to begin during May 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N17.

13V-120

Chrysler Group LLC (Chrysler) is recalling certain model year 2007-2008 Dodge Nitro 4X2 vehicles manufactured March 21, 2006, through March 1, 2008; and 2008 Jeep Liberty 4X2 vehicles manufactured February 15, 2007, through March 1, 2008. The transfer case heat shield may drop down and rub on the drive shaft, weakening it and potentially causing the drive shaft to break. If the drive shaft breaks, a section of it can strike the transfer case tunnel with enough force that the airbag computer will believe the vehicle is in a crash and thus deploy the airbags. Additionally, the drive shaft failure will result in a loss of motive power. Either condition may increase the risk of a crash. Chrysler will notify owners, and dealers will add a bracket to support the rear of the heat shield, free of charge. The recall is expected to begin during May 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N10.

13V-121

Chrysler Group LLC (Chrysler) is recalling certain model year 2013 Dodge Ram 2500 and 3500 trucks manufactured January 7, 2013, through March 6, 2013. The engine cover may trap an excessive amount of heat under the cover. The excessive heat under the engine cover may result in an under hood fire. Chrysler will notify owners, and dealers will replace the existing engine cover with one that is a different design, free of charge. The recall is expected to begin during May 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N19.

13V-122

Southeast Toyota is recalling certain model year 2008 and 2010-2013 Toyota Tundra, 2010-2012 Rav4, 2012 Toyota Sequoia, 2010-2011 Toyota Corolla, 2010-2011 Toyota Camry and Camry Hybrid, 2010-2013 Toyota Highlander and Highlander Hybrid, 2010-2013 Toyota FJ Cruiser, 2011 Toyota Land Cruiser, 2010-2013 Toyota Venza, 2010-2011 Toyota 4Runner, 2010-2013 Toyota Tacoma, 2011-2012 Toyota Sienna, 2012 Toyota Prius, 2013 Scion FR-S, 2011 Scion XD, 2011 Scion XB, and 2012 Scion TC vehicles. These vehicles were sold with labels that were outside the allowable one percent of accuracy of actual weight added. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS)

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2013

Published May 7, 2013

Number 110, "Tire Selection and Rims." An inaccurate label could lead to owners overloading their vehicles and tires. An overloaded vehicle can result in a tire failure which may result in a vehicle crash, personal injury, or property damage. Southeast Toyota will notify owners and provide a corrected label with instructions concerning its installation. A small group of the affected vehicles will need additional remedies which are still being developed. The recall is planned to begin during May 2013. Owners may contact Southeast Toyota at 1-800-301-6859.

13V-123

Chrysler Group LLC (Chrysler) is recalling certain model year 2013 Dodge Dart vehicles manufactured on November 27, 2012. Some vehicles may have been built with incorrect rear brake calipers, which could result in an inoperable parking brake. If the parking brake is inoperable, the vehicle could roll when parked increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the affected brake calipers, free of charge. The recall began on April 29, 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N21.

13V-124

Blue Bird is recalling certain model year 2008 through 2011 All American rear engine school buses manufactured from August 9, 2007, through June 9, 2010, powered by Cummins ISB07 engines. In the affected vehicles, the grid heater power cable may be improperly routed, which could result in contact with the chassis frame rail. If the cable contacts the chassis frame rail it could potentially chafe against the frame thereby creating a direct short which could result in a fire. Blue Bird will notify owners, and dealers will inspect the buses for proper positioning of the grid heater power cable. Any cables found contacting the chassis frame rail will have the grid heater cable repositioned to prevent further contact. Any damaged cables found will be replaced. The repairs will be made free of charge. The recall began on May 3, 2013. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's recall campaign number is R13WD.

13V-125

Blue Bird is recalling certain model year 2008 through 2011 All American rear engine, non-school, transit buses manufactured from August 9, 2007, through June 9, 2010, and powered by Cummins ISB07 engines. In the affected vehicles, the grid heater power cable may be improperly routed, which could result in contact with the chassis frame rail. If the cable contacts the chassis frame rail it could potentially chafe against the frame thereby creating a direct short which could result in a fire. Blue Bird will notify owners, and dealers will inspect the buses for proper positioning of the grid heater power cable. Any cables found contacting the chassis frame rail will have the grid heater cable repositioned to prevent further contact. Any damaged cables found will be replaced. The repairs will be made free of charge. Notification to owners began on May 3, 2013. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's recall campaign number is R13WD.

13V-126

Daimler Trucks North America (DTNA) is recalling certain model year 2012-2014 Cascadia and Coronado vehicles manufactured between November 21, 2011, and April 3, 2013. In the affected vehicles, when the ignition is off and the door is opened without the parking brake applied, the dashboard does not display the correct message of "Park Brake Off Door Open." Without the proper warning, a driver may not be reminded to

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2013

Published May 7, 2013

apply the parking brake which may lead to a vehicle roll away, increasing the risk of a crash. DTNA will notify owners, and dealers will update then display software. The safety recall is planned to begin on, or about June 5, 2013. Owners may contact DTNA at 1-800-547-0712. Daimler's recall campaign number is FL-642.

13V-127

Chrysler Group LLC (Chrysler) is recalling certain model year 2013 Dodge Ram 1500 vehicles manufactured December 17, 2012, through January 22, 2013. The parking brake cable equalizer was set incorrectly and may not hold the vehicle on a 20% grade. Thus, these vehicles fail to conform to the parking brake performance requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 135, "Light Vehicle Brake Systems." If the parking brake fails to operate as designed, the vehicle could roll when parked, increasing the risk of a crash. Chrysler will notify owners, and dealers will reset the parking brake cable equalizer if required, free of charge. The recall began on April 22, 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N22.

13V-128

Load Trail LLC (Load Trail) is recalling certain model year 2011-2012 Load Max HD Goosenecks trailers manufactured October 21, 2011, through May 9, 2012. These vehicles are equipped with Carlisle hydraulic brake actuators. One of the rotating components in the hydraulic pump missed a heat treat operation causing the actuator to wear at a higher than normal rate. As a result, the hydraulic pump could fail and result in a loss of braking ability in the trailer. Loss of braking ability can lead to loss of control of the trailer, increasing the risk of a crash, serious injuries, or property damage. Load Trail will notify owners, and dealers will replace the hydraulic pumps free of charge. The recall began on April 18, 2013. Owners may contact Load Trail at 1-903-783-3900.

13V-129

Mazda is recalling certain model year 2003-2004 Mazda6 vehicles manufactured January 14, 2003, through May 29, 2003; and 2004 RX-8 vehicles manufactured June 25, 2003, through June 30, 2003, to address a safety defect in the passenger side air bag which may produce excessive internal pressure causing the inflator to rupture upon deployment of the air bag. This recall addresses the passenger air bags that were originally installed in the vehicles, as well as replacement air bags that may have been installed as replacement service parts. A replacement air bag may have been installed, as one example, if a vehicle had been in a crash necessitating the replacement of the passenger side air bag. In the event of a crash necessitating deployment of the passenger's air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the passenger seat occupant or other occupants. Owners of all vehicles on which a defective air bag may have been installed either as original equipment, or as a replacement, will be notified. Dealers will inspect vehicles, and where a defective air bag inflator is identified, the inflator will be replaced, free of charge. The safety recall will begin in May 2013. Owners may contact Mazda Customer Assistance Center at 1-800-222-5500, option #6. Mazda's recall campaign number is 6913D.

13V-130

North American Bus Industries (NABI) is recalling certain model year 2008-2013 416 and model year 2012 31LFW transit buses manufactured October 30, 2008, through April 3, 2013 and equipped with a four-position

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING APRIL 2013

Published May 7, 2013

rotary defroster switch with ring terminals. The defroster switch may overheat and melt the dash. The overheating of the switch may lead to a fire or distract the driver and increase the risk of an accident. NABI will notify owners and will install relays to reduce the current flow. This will be done free of charge. Owners may contact NABI at 1-256-831-4296. NABI's campaign number is 20133.

13V-131

Honda is recalling certain model year 2001-2003 Civic, model year 2002-2003 CR-V, and model year 2002 Odyssey vehicles to address a safety defect in the passenger side frontal air bag which may produce excessive internal pressure causing the inflator to rupture upon deployment of the air bag. This recall addresses both the passenger side frontal air bags that were originally installed in the vehicles, as well as replacement air bags that may have been installed as replacement service parts. A replacement air bag may have been installed, as one example, if a vehicle had been in a crash necessitating the replacement of the passenger side frontal air bag. In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the passenger seat occupant or other occupants. Owners of all vehicles on which a defective air bag may have been installed either as original equipment, or as a replacement, will be notified. Dealers will inspect vehicles, and where a defective air bag inflator is identified, the inflator will be replaced, free of charge. The safety recall will begin on May 11, 2013. Owners may contact Honda automobile customer service at 1-800-999-1009. Honda's recall campaign number is S95.

13V-132

Toyota is recalling certain model year 2002 through 2004 Toyota Corolla, Corolla Matrix, Sequoia, Tundra, Lexus SC, and Pontiac Vibe vehicles to address a safety defect in the passenger side frontal air bag which may produce excessive internal pressure causing the inflator to rupture upon deployment of the air bag. This recall addresses both the passenger side frontal air bags that were originally installed in the vehicles, as well as replacement air bags that may have been installed as replacement service parts. A replacement air bag may have been installed, as one example, if a vehicle had been in a crash necessitating the replacement of the passenger side frontal air bag. In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the passenger seat occupant or other occupants. Toyota will notify owners of affected Toyota and Lexus vehicles and General Motors will notify owners of affected Pontiac Vibe vehicles. Toyota, Lexus, and GM dealers will inspect vehicles, and where a defective air bag inflator is identified, the inflator will be replaced, free of charge. The manufacturer has not yet provided the agency with a notification schedule. Toyota and Lexus owners may contact Toyota at 1-800-331-4331. Pontiac Vibe owners may contact GM at 1-800-521-7300.

13V-133

Altec is recalling certain model year 2010-2012 AC18, AC23, and AC38 cranes with front bumper outriggers mounted on Kenworth chassis between November 2010 and October 2012. The brackets that attach the outrigger to the front bumper of the chassis may be inadequate to support the full capacity of the crane in certain positions. The inadequate mounting brackets may allow the outrigger to bend, reducing the stability of the crane truck which could result in injury, death, and/or property damage. Altec will notify owners and dealers will replace the front bumper outrigger attachments. Altec has not provided a notification schedule. Owners may contact Altec at 1-877-462-5832. Altec's recall campaign number is CSN 573.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2013

Published May 7, 2013

13V-134

Temsa Global is recalling certain model year 2011-2013 TS35C and 2012-2013 TS30 motor coach buses. First, the two service air brake pressure gauges are both reading the pressure of the same air tank. Second, the ABS system malfunction indicator light does not illuminate momentarily when the key is turned to the 'ON' or 'RUN' position. Thus, these vehicles fail to comply with Federal Motor Vehicle Safety Standard No. 121, "Air Brake Systems." Without accurate gauges, the driver may not notice the pressure change in the secondary brake system. The driver may also not be aware of an ABS issue without the bulb illuminating each time the key is turned on. Either issue increases the risk of a crash. Temsa will notify owners and they will update the software, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Temsa Global at 1-404-602-0151.

13V-135

Nissan is recalling certain model year 2001-2003 Maxima, Pathfinder, and Infiniti I35; model year 2002-2003 Infiniti QX4; and model year 2003 Infiniti FX35 and FX45 and possibly certain Sentra vehicles to address a safety defect in the passenger side frontal air bag which may produce excessive internal pressure causing the inflator to rupture upon deployment of the air bag. This recall addresses both the passenger side frontal air bags that were originally installed in the vehicles, as well as replacement air bags that may have been installed as replacement service parts. A replacement air bag may have been installed, as one example, if a vehicle had been in a crash necessitating the replacement of the passenger side frontal air bag. In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the passenger seat occupant or other occupants. Owners of all vehicles on which a defective air bag may have been installed either as original equipment, or as a replacement, will be notified. Dealers will inspect vehicles, and where a defective air bag inflator is identified, the inflator will be replaced, free of charge. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact Nissan Customer Service at 1-800-647-7261.

13V-136

Kovatch Mobile Equipment Corp. (Kovatch) is recalling certain model year 2012-2013 Predator, Predator SS, Panther, and model year 2011 Panther II emergency vehicles manufactured February 1, 2011, through February 28, 2013. These vehicles are equipped with Meritor axle assemblies that were built with disc brakes using MGM J24 series air brake chambers. In the affected axles, the brake chambers may leak pressure allowing the parking brake to drag when it is supposed to be released. Brake dragging could lead to overheated brake components. Overheated brake components could result in a fire. Kovatch will notify owners and will replace the actuators as needed, free of charge. The safety recall is expected to begin in May 2013. Owners may contact Kovatch at 1-570-669-5132.

13V-137

Autocar, LLC is recalling certain model year 2011-2013 ACX vehicles manufactured January 24, 2011, through December 4, 2012. These vehicles are equipped with Meritor axle assemblies that were built with disc brakes using MGM J24 series air brake chambers. In the affected axles, the brake chambers may leak pressure allowing the parking brake to drag when it is supposed to be released. Brake dragging could lead to overheated

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2013

Published May 7, 2013

brake components. Overheated brake components could result in a fire. Autocar will notify owners and will replace the actuators as needed, free of charge. The safety recall is expected to begin June 10, 2013. Owners may contact Autocar at 1-765-489-5499. Autocar's campaign recall number is A-1301.

13V-138

Nissan is recalling certain model year 2013 Pathfinder and Infiniti JX vehicles manufactured December 3, 2012, through January 29, 2013. The front brake torque member was improperly cast resulting in structural weakness. This can lead to premature failure and cracking. If the brake torque member fails, the brake caliper may move and contact the inside of the road wheel, resulting in reduced braking, increasing the risk of a crash. Nissan will notify owners, and dealers will inspect the manufacturing date of the torque members and replace them, as necessary, free of charge. The recall is expected to begin in early May 2013. Owners may contact Nissan Customer Service at 1-800-647-7261.

13V-139

Seagrave Fire Apparatus, LLC (Seagrave) is recalling certain model year 2011 and 2012 Marauder II pumper emergency vehicles, models TB70CM, TB50CL, TB40CL, TB70CX, TB70CL and TB70CO manufactured from November 23, 2010, through October 22, 2012. These vehicles are equipped with Meritor axle assemblies that were built with disc brakes using MGM J24 series air brake chambers. In the affected axles, the brake chambers may leak pressure allowing the parking brake to drag when it is supposed to be released. Brake dragging could lead to overheated brake components. Overheated brake components could result in a fire. Seagrave will notify owners and the actuators will be replaced as needed, free of charge. The safety recall began on April 23, 2013. Owners may contact Seagrave's OnTrac Customer service center at 1-866-668-7221.

13V-140

Altec Industries, Inc (Altec) is recalling certain model year 2007-2012 DC, and DL/DM Digger Derrick utility trucks, equipped with boom tip winches using Tulsa Winch Group (formerly Gear Products) winch drums. In the affected vehicles, the winch drum could deform or fracture. If the winch fails while in use, it could cause personal injury. Altec will notify owners and dealers will replace the winch drum, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Altec at 1-877-462-5832. Altec's recall campaign number is CSN 574.

13V-141

Motor Coach Industries (MCI) is recalling certain model year 2012-2013 D4000, D4000ISTV, D4005, D4500, and D4505 motorcoaches manufactured from May 2012 through December 2012 and equipped with a Cummins ISX EPA 2010 engine. In the affected buses, the bellows pipe in the exhaust system may have been incorrectly assembled, which could result in a failure of the pipe during operation. During a regeneration process to clean exhaust emissions, if the bellows pipe has failed, the hot exhaust gases may not be contained, resulting in a fire. MCI will notify owners and dealers will inspect and replace the bellows pipes, as necessary, free of charge. The recall is expected to begin in May 2013. Customers may contact MCI at 1-847-285-2000.

13V-142

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING APRIL 2013

Published May 7, 2013

Honda is recalling certain model year 2012-2013 CR-V, Odyssey, and model year 2013 Acura RDX vehicles. During sub-freezing temperatures, the brake-shift interlock blocking mechanism may become slow and allow the gear selector to be moved from the Park position without pressing the brake pedal. As such, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard 114, "Theft Protection and Rollaway Prevention." If the gear selector is moved from the park position without pressing the brake pedal it can allow the vehicle to roll away, increasing the risk of a crash. If the gear selector is moved from the park position without pressing the brake pedal it can allow the vehicle to roll away, increasing the risk of a crash. Honda will notify owners and instruct them to take their vehicle to a Honda or Acura dealer. The dealer will install an updated brake shift interlock blocking mechanism free of charge. The recall is expected to begin May 13, 2013. Owners may contact Honda at 1-800-999-1009. Honda's campaign recall numbers are S96, S97, and S98.

13V-143

Dutchmen Manufacturing Inc. is recalling certain model year 2013 Dutchmen 245RKS recreational vehicles for failing to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) Number 110, "Tire Selection and Rims." On these vehicles, the Federal identification tag lists the wrong Gross Vehicle Weight Rating and the wrong Gross Axle Weight Rating. Dutchmen will notify owners and mail replacement labels with corrected information, free of charge. The recall is expected to begin in May 2013. Owners may contact Dutchmen at 1-574-537-0700.

13V-144

E-One Incorporated (E-One) is recalling certain model year 2011-2013 Cyclone II fire fighting vehicles manufactured from April 22, 2011, through February 8, 2013. These vehicles are equipped with Meritor axle assemblies that were built with piston air parking brake actuators. In the affected axles, the brake chambers may leak pressure allowing the parking brake to drag when it is supposed to be released. Brake dragging could lead to overheated brake components. Overheated brake components could result in a fire. E-One will notify owners and the actuators will be replaced as needed, free of charge. The recall began on May 6, 2013. Owners may contact E-One at 1-352-237-1122. E-One's number for this campaign is 4EN.

13V-145

Navistar is recalling certain model year 2011-2012 International Lonestar, model year 2012-2013 International Terrastar and model year 2011-2013 International DuraStar, ProStar, TranStar, and WorkStar commercial trucks manufactured from June 1, 2010, through March 7, 2012 and equipped with day cab codes 16CAB, 16030, or 16196 and feature codes 16WCE, 16WCR, 16XWD, 16XWE, 16XWV, 16XXB, 16XXD, 16XXE, 16XXG, or 16XYN sun shades. The sun shade may not be properly secured to the cab roof panel which may result in partial or full separation of the sun shade from the roof panel. If the sun shade separates from the cab roof during vehicle operation, the sudden release of the sun shade could distract the driver increasing the risk of a crash. Navistar will notify owners, and dealers will inspect and strengthen the sun shade mounting, free of charge. The safety recall is expected to begin by June 17, 2013. Owners may contact Navistar at 1-800-448-7825. Navistar's campaign number is 13505.

13V-146

Explorer Van Company, Inc. is recalling certain model year 2013 Explorer and Explorer Limited SE vehicles

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING APRIL 2013

Published May 7, 2013

built on GMC Savana and Chevrolet Express chassis, manufactured August 1, 2012, through April 9, 2013. The wiring harness that powers the seat adjuster and the seat heating circuit may not be properly secured. As a result, the harness may become lodged in the seat riser mechanism. If the wires become lodged in the seat riser mechanism, they may become severed and potentially short circuit. A short circuit may result in a fire. Explorer Van Company will notify owners, and dealers will secure the seat wiring harness. Any damaged seat wiring harnesses will be replaced. These services will be completed free of charge. The recall is expected to begin May 17, 2013. Customers may contact Explorer Van Company at 1-800-926-7878. Explorer's number for this campaign is 2013-1.

13V-147

Prevost is recalling one model year 2013 H3-45 coach bus manufactured November 14, 2011, through July 3, 2012. In the affected bus, the transmission has the wrong software and may not lock to prevent movement while the wheelchair lift door is open. Thus, this bus fails to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 403, "Platform Lift Systems for Motor Vehicles." Without the transmission locking to prevent movement, if the parking brake lock fails while the wheelchair lift door is open, the bus may unexpectedly move, increasing the risk of injury. Prevost has notified the owner, and the transmission is being reprogrammed, free of charge. Owners may contact Prevost at 1-418-883-2888 x 6558. Prevost's campaign recall number is SR13-25.

13V-149

Prevost is recalling certain model year 2012-2013 X3-45 VIP, 2006-2013 H3-45 VIP, 2006-2011 XLII-45, and 2006-2013 XLII-45 Entertainer coach buses equipped with window part numbers: 790612, 790613, and 790614. These vehicles were manufactured November 15, 2005 through February 6, 2013. The affected buses may have decals that list an improper sequence of steps to exit the vehicle through the emergency exit. In the event of a crash, the incorrect label may result in difficulty opening the emergency windows. This could increase the risk of personal injury. Prevost will notify owners, and dealers will replace the emergency window decals, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Prevost at 1-418-883-2888 x 6558. Prevost's campaign recall number is SR13-26.

13V-150

Forest River is recalling certain model year 2013 Shasta Revere model SHT27DB, SHT30BH, SHT27BH, SHT26TB, and SHT27KS trailers manufactured September 4, 2012, through April 10, 2013. These vehicles were manufactured with incorrect tire load rating and pressure information on the Federal Certification Tag and Tire Information Tag. Thus, these trailers fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 120, "Tire Selection and Rims for Motor Vehicles Other Than Passenger Cars." The incorrect tire pressure information given on the Federal Certification Tag and Tire Information Tag may lead to the tire being overinflated, resulting in sudden tire failure, increasing the risk of a crash. Forest River will notify owners and send corrected labels. The manufacturer has not yet provided a notification schedule. Customers may contact Forest River at 1-574-825-7178.

13V-151

Volvo Trucks North America (Volvo) is recalling certain model year 2011-2013 VHD and VNL vehicles

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING APRIL 2013

Published May 7, 2013

manufactured December 13, 2010, through July 17, 2012. These vehicles are equipped with an MGM Type 24 J-series piston parking brake chamber. The brake chambers may leak pressure allowing the parking brake to drag when it is supposed to be released. Brake dragging could lead to overheated brake components. Overheated brake components could result in a fire. Volvo will notify owners and the brake chambers will be replaced as needed, free of charge. The safety recall is expected to begin on, or before, June 17, 2013. Owners may contact Volvo at 1-336-393-2000. Volvo's campaign recall number is RVXX1302.

13V-152

Mack Trucks, Inc. is recalling certain model year 2011-2013 CXU trucks manufactured November 23, 2010, through March 19, 2012. These vehicles are equipped with an MGM Type 24 J-series piston parking brake chamber. In the affected axles, the brake chambers may leak pressure allowing the parking brake to drag when it is supposed to be released. Brake dragging could lead to overheated brake components. Overheated brake components could result in a fire. Mack Trucks will notify owners and the brake chambers will be replaced as needed, free of charge. The safety recall is expected to begin on, or before, June 17, 2013. Owners may contact Mack at 1-336-393-2000. Mack Truck's campaign recall number is SC0369.

13V-153

BMW is recalling certain model year 2013 R1200 GS motorcycles manufactured January 9, 2013, through February 8, 2013. Due to an insufficient torque of a locking bolt, the front fork tube may loosen. If the fork loosens it may hinder the rider's ability to control the motorcycle, increasing the risk of a crash. BMW will notify owners and dealers will reinforce the affected fork locking bolt connections, free of charge. Owners may call BMW at 1-800-525-7417 or email BMW at CustomerRelations@bmwusa.com.

13V-154

Keystone RV Company (Keystone) is recalling certain model year 2013-2014 recreational trailers equipped with Dometic 9100 Power Awnings or Weather Pro awnings, awning serial numbers 306xxxx through 314xxxx, manufactured between February 13, 2013, through April 9, 2013. If the awning installation sequence was not completely followed, the awning motor may unknowingly become damaged. A damaged motor may lead to an unfurling of the awning. If the awning unfurls unexpectedly either in transit or while parked, it may increase the risk of personal injury or a crash. Keystone will notify owners and dealers will replace the awning motor, free of charge. The recall is expected to begin in May 2013. Owners may contact Keystone at 1-866-425-4369. Keystone's campaign recall number is 13-193.

13V-155

Triple E Recreational Vehicles (Triple E) is recalling certain model year 2012-2013 Libero L24CB, Serenity S24CB, Regency GT (GT24MB, GT27S, GT28D, GT29T), and Unity (U24CB, U24IB, U24TB, U24MB). The light for the license plate does not adequately illuminate the license plate to have it be visible when it is dark out. Therefore, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 108, "Lamps, Reflective Devices, and Associated Equipment." Without license plate illumination, the vehicle may be difficult to identify at night. Triple E Recreational Vehicles will notify owners and dealers will install a new license plate lamp, free of charge. The recall is expected to begin in early-May 2013. Owners may contact Triple E at 1-877-992-9906. Triple E's number for this campaign is CA#7719-1.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2013

Published May 7, 2013

13V-156

Honda is recalling certain model year 2012-2013 Honda Fit Sport vehicles manufactured May 23, 2011, through March 22, 2013. The electronic stability control system of the affected vehicles may allow excessive yaw rates at high steering angles with certain tires. Thus, these vehicles fail to conform to the requirements of Federal Vehicle Motor Safety Standard No. 126, "Electronic Stability Control Systems." Excessive yaw rates prevent the proper function of the electronic stability control (ESC) system, increasing the risk of a crash. Honda will notify owners and dealers will update the ESC software free of charge. The safety recall will begin on May 17, 2013. Owners may contact Honda automobile customer service at 1-800-999-1009. Honda's recall campaign number is S99.

13V-157

Nissan North America is recalling certain model year 2013 Altima vehicles manufactured March 21, 2012, through March 26, 2013. The spare tires may have been significantly over- or under-inflated. Tires that are significantly over- or under-inflated may fail without warning, increasing the risk of a crash. Nissan will notify owners, and dealers will inspect and adjust the spare tire pressure, as necessary, free of charge. The recall is expected to begin during 2013. Owners may contact Nissan at 1-800-647-7261.

13V-158

Subaru is recalling certain model year 2014 Forester vehicles manufactured from January 2013 through March 2013. The backing for the carpeted floor mats was not manufactured to specification. As a result, the floor mats may curl when exposed to heat. Curling of the driver side floor mat could distract the driver and/or interfere with proper operation of one or a combination of, the vehicle's clutch, brake, and accelerator pedals. Brake or accelerator pedal interference may result in very high vehicle speeds and make it difficult to stop the vehicle, which could cause a crash. Subaru will notify owners, and dealers will replace each of the vehicle's four (4) carpeted floor mats with new ones. These services will be performed free of charge. Subaru issued an interim notification during April 2013. Owners may contact Subaru at 1-800-782-2783. Subaru's recall campaign number is WQH-44.

13V-159

Terex South Dakota, Inc. (Terex) is recalling certain model year 1998-2005 OM Aerial Devices used on utility trucks. The leveling arm at the elbow can develop fatigue cracks. Fatigue cracks may cause the leveling arm to fail. If the arm fails while the aerial device is in use, the platform may move unexpectedly, increasing the risk of injury to the operator or those nearby. Terex will notify owners to inspect their unit immediately and arrange repairs with Terex or dealers. Repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Terex at 1-605-884-3892. Terex's recall campaign number is SN606.

13V-160

Winnebago Industries is recalling certain model year 2012-2014 Minnie Winnie, Chalet, Aspect, Sightseer, Adventurer, and Journey motorhomes; and model year 2012-2014 Itasca Spirit, Cambria, Sunova, Suncruiser, and Meridian motorhomes. The affected vehicles were manufactured January 10, 2012, through April 5, 2013

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING APRIL 2013

Published May 7, 2013

and may be missing a range enclosure. A missing range enclosure may allow the gas range flame to be extinguished due to air flow. In such a case, propane gas will continue to flow without a flame. If propane continues to flow, in the presence of an ignition source, it may suddenly combust resulting in a fire and/or personal injury. Winnebago notify owners and dealers will install a range enclosure, free of charge. The safety recall will begin by the end of May 2013. Owners may contact Winnebago at 1-641-585-3535. Winnebago's recall campaign number is 128.

13V-161

Winnebago Industries, Inc. (Winnebago) is recalling certain model year 2013-2014 Winnebago Access, Aspect, Sightseer, Vista, Adventurer, Forza and Itasca Impulse, Cambria, Sunova, Sunstar, Suncruiser motorhomes manufactured February 20, 2013, through April 25, 2013. If the awning installation sequence was not completely followed, the awning motor may unknowingly become damaged. A damaged motor may lead to an unfurling of the awning. If motor damage occurs, it is possible that the awning can unfurl unexpectedly, either while the motorhome is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Winnebago will notify owners and Dometic staff will replace the affected motors with a design that is not subject to an out-of-sequence installation error. Winnebago has not yet provided a notification schedule. Owners may contact Winnebago at 1-800-537-1885 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-162

Toyota Motor Corporation (Toyota) is recalling certain model year 2007-2013 FJ Cruiser vehicles manufactured January 25, 2006 through February 23, 2013 and equipped with a Toyota Auxiliary Driving Lamp Kits mounted to the front bumper. These lamp assemblies include 55 watt bulbs and due to this wattage and mounting angle, the combination of the upper beam headlamps plus the auxiliary lamps are too bright and exceed the maximum light output allowed for an upper beam headlamp. Therefore, these vehicles fail to conform to Federal Motor Vehicle Safety Standard No. 108, "Lamps, reflective devices, and associated equipment." Light intensities above the maximum allowable limit could cause increased glare for oncoming traffic and increase the risk of a crash. Toyota will notify owners, and dealers will replace the 55 watt bulbs with 35 watt bulbs, free of charge. The recall is expected to begin in late May 2013. Owners may contact Toyota at 1-800-331-4331.

13V-163

Thor Motor Coach is recalling certain model year 2013-2014 Challenger, Four Winds 5000, Hurricane, Chateau, Chateau Sport, and Windsport; model year 2013 Palazzo and Four Winds Siesta and model year 2014 Majestic motorhomes manufactured February 13, 2013, through April 09, 2013. If the awning installation sequence was not completely followed, the awning motor may unknowingly become damaged. A damaged motor may lead to an unfurling of the awning. If motor damage occurs, it is possible that the awning can unfurl unexpectedly, either while the motorhome is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Thor Motor Coach will notify owners and Dometic staff will replace the affected motors with a design that is not subject to an out-of-sequence installation error. Thor has not yet provided a notification schedule. Owners may contact Thor at 1-877-855-2867 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-164

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING APRIL 2013

Published May 7, 2013

Westmor Industries, LLC. (Westmor) is recalling certain model year 2003-2013 trailers equipped with Fisher-branded H732 and H832 pressure relief valves, manufactured by Emerson Process Management Regulatory Technologies, Inc. (Emerson) between January 2003 and January 2013. The stem of the valve may break, resulting in separation. This may result in the valve being ejected and pressurized gas being released into the atmosphere. The ejected valve could strike another vehicle and cause personal injury or a vehicle crash. The release of gas near an ignition source could also lead to a vehicle fire. Westmor will notify owners and Emerson will replace the valves free of charge. The manufacturer has not yet provided a notification schedule. Customers may contact Westmor at 1-800-992-8981.

13V-165

Mercedes-Benz USA, LLC (Mercedes) is recalling certain model year 2013 GL350 BlueTEC, GL450 4MATIC, GL550 4MATIC, and GL63 AMG vehicles manufactured May 15, 2012 through October 4, 2012. The second row seat belt anchor fitting bolts may not be properly torqued. If the bolts are not properly torqued, the seat belt anchor bolts may continue to loosen and in the the event of a crash, the belted occupant may not be properly restrained, increasing the risk of injury. Mercedes-Benz will notify owners and dealers will check, and tighten the bolts of the seat belt anchor fittings, as necessary, free of charge. The recall campaign is expected to begin in May 2013. Owners may contact Mercedes-Benz at 1-800-367-6372.

13V-166

HME is recalling certain model year 2012 Spectr Fire Apparatus, Spectr Chassis, and 2011-2012 Ferrara Intruder Ember Chassis vehicles manufactured January 26, 2011, through November 7, 2012. These vehicles have axles are equipped with an MGM Type 24 J-series piston parking brake chamber. In the affected axles, the brake chambers may leak pressure allowing the parking brake to drag when it is supposed to be released. Brake dragging could lead to overheated brake components. Overheated brake components could result in a fire. HME will notify owners and the brake chambers will be inspected and replaced as needed, free of charge. The safety recall is expected to begin on, or before, May 13, 2013. Owners may contact HME at 1-616-534-1463.

13V-167

Jayco is recalling certain model year 2013-14 Eagle Premiere, Jay Feather Ultra Lite, Jay Flight, Jay Flight Swift, Octane, and White Hawk; model year 2013 Eagle, Eagle HT, Jay Flight Bungalow, Jay Flight Destination, Pinnacle, Redhawk and Seismic; and model year 2014 Precept recreational vehicles. In these vehicles, if the awning installation sequence is not completely followed, the awning motor may unknowingly become damaged. If motor damage occurs, it is possible that the awning can unfurl unexpectedly, either while the motorhome is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Jayco will notify owners and dealers will inspect and replace the awning motor free of charge. The recall is expected to begin in May 2013. Owners may contact Jacyo at 1-800-283-8267 for more information.

13V-168