

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2013

Published June 11, 2013

CHILD SEATS:

None during May 2013.

EQUIPMENT:

Koni North America (KONI) is recalling certain shock absorbers with model numbers 8245-1146L, 8245-1146R, 8245-1201L, 8245-1201R, 8245-1203L, and 8245-1203R. These shock absorbers were manufactured January 2008 through April 2013. The affected absorbers were manufactured with an incorrectly welded bracket which may cause the shock absorber to bend and rest on the drive shaft. A bent shock absorber may compromise vehicle handling, increasing the risk of a crash. KONI will notify distributors and advise them to contact their customers of the recall. The shock absorbers will be replaced free of charge. The recall began on May 16, 2013. Customers may contact KONI at 1-800-209-3350.

13E-023

Dorman is recalling certain master cylinders, model number M630274-BX, manufactured by Bosch. The brake fluid level indicator (FLI) may not properly detect a low brake fluid level situation and warn the driver. If the brake system develops an external leak, it may result in a loss of brake fluid below the detection level of the fluid indicator switch. Without a warning, the driver may be unaware that the brake fluid level is low. A low brake fluid level may reduce the available braking force which could lengthen the required stopping distance and increase the risk of a crash. Dorman will notify owners and Bosch will replace the fluid level indicator switch free of charge. The recall is expected to begin during June 2013. Owners may contact Dorman Customer Service at 1-800-523-2492.

13E-024

KBC America, Inc. (KBC) is recalling certain Harley-Davidson Hybrid C/C Half Motorcycle Helmets, size Large, manufactured in March 2011. During testing, the affected helmets failed to conform to the impact attenuation and penetration requirements of Federal Motor Vehicle Safety Standard No. 218, "Motorcycle Helmets." By wearing a noncompliant helmet, the user may not be adequately protected in the event of a crash, increasing the risk of personal injury. The remedy for this recall campaign is still under development. The manufacturer has not yet provided a notification schedule. Customers may contact KBC at 1-818-526-7771.

13E-025

Brake Parts Inc. (BPI) is recalling certain Hydro-Max brake master cylinders branded as Raybestos p/n MC390565, NAPA p/n 390565, Carquest p/n E151557, and GM AC Delco p/n 18M870. These cylinders contain a 2.0 inch bore and 84 cubic inch reservoir equipped with a brake fluid level indicator switch and without a differential pressure switch, manufactured between July 1, 2011 and April 12, 2012. The brake fluid level indicator (FLI) may not properly detect a low brake fluid level situation and warn the driver. If the brake system develops an external leak, it may result in a loss of brake fluid below the detection level of the fluid indicator switch. Without a warning, the driver may be unaware that the brake fluid level is low. A low brake fluid level may reduce the available braking force which could lengthen the required stopping distance and increase the risk of a crash. BPI will notify customers and replace the fluid level indicator switch free of charge. The recall is expected to begin during June 2013. Owners may contact BPI at 1-815-363-9000.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2013

Published June 11, 2013

13E-026

Centric Parts is recalling certain Hydro-Mar master cylinders manufactured by Bosch from July 1, 2011 through April 12, 2012. The master cylinders are equipped with a 2.0 bore and 84 cubic inch reservoir containing a fluid level indication switch and without a differential pressure switch. The brake fluid level indicator (FLI) may not properly detect a low brake fluid level situation and warn the driver. If the brake system develops an external leak, it may result in a loss of brake fluid below the detection level of the fluid indicator switch. Without a warning, the driver may be unaware that the brake fluid level is low. A low brake fluid level may reduce the available braking force which could lengthen the required stopping distance and increase the risk of a crash. Centric Parts is working with Bosch to notify owners and Bosch will replace the fluid level indicator switch free of charge. Notification to owners began during May 2013. Owners may contact Centric Parts at 1-626-961-5775.

13E-027

Yakima Products, Inc. (Yakima) is recalling certain Whispbar rack systems. The fitting kits (part numbers K558, K393, K421, K491, K422, K543, K480 & K508) for Infiniti G-sedans (07-13), Audi Q7, A3/A4/A6 Wagons, Kia Sportage, Toyota Matrix (2009-2013), and Mitsubishi Outlander Sport vehicles do not properly fit the roofline or raised rail of the vehicle. The rack may separate from the vehicle while driving, causing a hazard to other vehicles on the road, increasing the risk of a crash. Yakima will notify owners and instruct them to return the parts to a Yakima dealer for a replacement Yakima rack system or for a refund of the customers money. The recall began on June 7, 2013. Owners may contact Yakima customer service at 1-888-925-4621 or Fitkitrecall@Whispbar.com.

13E-028

Motovan Corporation is recalling certain Zox Old School Motorcycle Helmets, size XL, manufactured in December 2008. During testing, the affected helmets failed to conform to the impact attenuation and penetration requirements of Federal Motor Vehicle Safety Standard No. 218, "Motorcycle Helmets." By wearing a noncompliant helmet, the user may not be adequately protected in the event of a crash, increasing the risk of personal injury. Motovan will attempt to notify owners via motorcycle consumer magazines since they have no record of the owners. The remedy for this recall campaign is still under development. Customers may contact Motovan at 1-450-449-3903.

13E-029

BMW of North America, LLC (BMWNA) is recalling dealer installed accessory luggage racks (part number 8 527 038) that can be equipped to 2013 BMW C650 GT Maxi-Scooters. During riding, the attachment bolts of the luggage rack could loosen. If the attachment bolts loosen, the luggage rack could separate from the scooter and become a road hazard for drivers of other vehicles, increasing the risk of a crash. BMWNA will notify owners, and dealers will replace the luggage rack free of charge. The recall is expected to begin in June 2013. Owners may call BMW at 1-800-525-7417 or email BMW at CustomerRelations@bmwusa.com.

13E-030

TIRES:

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2013

Published June 11, 2013

None during May 2013.

VEHICLES:

Newmar Corporation is recalling certain model year 2013 Bay Star Sport, Ventana and Ventana LE and model year 2013-2014 Bay Star, Canyon Star and Dutch Star motorhomes. If the awning installation sequence was not completely followed, the awning motor may unknowingly become damaged. If motor damage occurs, it is possible that the awning can unfurl unexpectedly, either while the motorhome is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Newmar will notify owners and Dometic staff will replace the affected motors with a design that is not subject to an out-of-sequence installation error. The manufacturer has not provided a notification schedule. Owners may contact Newmar at 1-574-773-7791 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-169

Newmar Corporation is recalling certain model year 2012-2013 Canyon Star motorhomes manufactured August 4, 2011, through February 19, 2013, for failing to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The affected vehicles may have missing reflectors on the rear cap. The absence of reflectors could reduce the ability for others to see the motorhome, increasing the risk that another vehicle may crash into the motorhome. Newmar will notify owners and dealers will install the required reflectors. The manufacturer has not yet provided a notification schedule. Owners may contact Newmar at 1-574-773-7791.

13V-170

Volvo Bus Corporation is recalling certain model year 2009-2013 9700 coaches manufactured from August 28, 2008, through April 19, 2013. Certain conditions may cause the affected coaches to go into a software controlled mode that would result in the throttle signal being fixed at 1750rpms regardless of throttle pedal input from the driver. The driver may lose the ability to control the bus's speed, increasing the risk of a crash. Volvo Bus will notify owners and dealers will remedy the software calibrations in the affected coaches, free of charge. The recall is expected to begin by July 1, 2013. Owners may contact Volvo Bus at 1-336-393-2000. Volvo Bus's recall campaign number is SR13-80.

13V-171

BMW is recalling certain model year 2002-2003 325i, 325xi, 330i, 330xi sedans; 325Ci and 330Ci coupes and convertibles; 325iT and 325xiT Sports Wagons; and M3 coupes and convertibles to address a safety defect in the passenger side frontal air bag which may produce excessive internal pressure causing the inflator to rupture upon deployment of the air bag. In the event of a crash necessitating deployment of the passenger's frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the passenger seat occupant or other occupants. BMW intends to issue initial notifications to owners informing them of the safety defect in June 2013. Once replacement parts are available, estimated for July, BMW will notify owners again to

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING MAY 2013

Published June 11, 2013

contact their dealers and schedule a replacement of the passenger air bag, free of charge. Owners may contact BMW customer service at 1-800-525-7417 or email BMW at CustomerRelations@bmwusa.com.

13V-172

General Motors (GM) is recalling certain model year 2012 and 2013 Buick LaCrosse and Regal, and model year 2013 Chevrolet Malibu Eco vehicles equipped with eAssist. These vehicles may have a condition in which the Generator Control Module (GCM) may not function properly. This could cause a gradual loss of battery charge and the illumination of the malfunction indicator light. If the vehicle is continued to be driven, the engine may stall and/or the vehicle may not start. In addition, there may be a burning or melting odor, smoke, and possibly a fire in the trunk. GM will notify owners and dealers will test the GCM and replace it, as necessary, free of charge. The recall is expected to begin during June 2013. Owners may contact GM at 1-800-521-7300. GM's recall campaign number is 13136.

13V-173

Dutchmen Manufacturing is recalling certain model year 2013 Breckenridge recreational vehicles manufactured February 13, 2013, through April 9, 2013. If the awning installation sequence was not completely followed, the awning motor may unknowingly become damaged. If motor damage has occurred, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Dutchmen will notify owners and dealers will replace the affected motors with a design that is not subject to an out-of-sequence installation error. This will be done at no cost to the owner. Owners are being instructed not to drive their vehicle until repairs can be performed. The recall began on May 30, 2013. Owners may contact Dutchmen at 1-574-537-0700.

13V-174

Chrysler Group LLC (Chrysler) is recalling certain model year 2005-2010 Jeep Grand Cherokee vehicles manufactured February 11, 2004, through March 9, 2010; and 2006-2010 Jeep Commander vehicles manufactured January 31, 2005, through March 10, 2010. A transfer case electrical failure may result in an unintentional shifting of the transfer case into the neutral position. If the vehicle shifts into neutral, it may roll away increasing the risk of a crash or personal injury. Chrysler will notify owners, and dealers will reflash the final drive controller which governs the transfer case, with new software, free of charge. The recall is expected to begin in June 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N23.

13V-175

Chrysler Group LLC (Chrysler) is recalling certain model year 2008-2012 Jeep Wrangler right-hand drive vehicles manufactured February 1, 2007, through October 10, 2011. The affected vehicles have airbag clockspring assemblies that could experience broken airbag circuits. In the event of a crash necessitating airbag deployment, a broken electrical circuit in the airbag clockspring wiring assembly can lead to non-deployment of the driver-side frontal airbag and will not be able to properly protect the driver, increasing the risk of injuries. Chrysler will notify owners, and dealers will replace the clockspring and add a steering wheel dust shield, free of charge. The recall is expected to begin during June 2013. Owners may contact Chrysler at 1-800-247-9753. This recall supercedes NHTSA recall 11V-528. Chrysler's recall campaign number is M31.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2013

Published June 11, 2013

13V-176

Chrysler Group LLC (Chrysler) is recalling certain model year 2013 RAM 1500 trucks manufactured June 25, 2012, through December 12, 2012. In the affected vehicles, the coolant bypass valve may stick in a position that does not allow coolant to flow into the heater core. Thus, these vehicles fail to conform to the requirements of Federal Vehicle Motor Safety Standard (FMVSS) No. 103, "Windshield Defrosting and Defogging Systems." Without a properly working windshield defrosting system, a buildup of moisture or ice could limit the driver's ability to see, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the suspect coolant valves along with an updated calibration, free of charge. The recall is expected to begin in June 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N25.

13V-177

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain model year 2013 Breeze and Allegro motorhomes. If the awning installation sequence was not completely followed, the awning motor may unknowingly become damaged. If motor damage has occurred, it is possible that the awning can unfurl unexpectedly, either while the motorhome is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Tiffin will notify owners and Dometic staff will replace the affected motors with a design that is not subject to an out-of-sequence installation error. The recall is expected to begin during June 2013. Owners may contact Tiffin at 1-256-356-8661 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-178

Lion Bus, Inc. is recalling one model year 2014 360 bus manufactured in December 2012. Due to insufficient distance between the air compressor discharge line and the hydraulic brake line, the lines may chafe against each other resulting in a hole in the brake line. A brake line hole could result in a loss of brake fluid. The fluid loss could lengthen the stopping distance required thus increasing the risk of a crash. Lion Bus will notify the owner and an Alliance Bus representative will modify the bus to ensure that there is adequate distance between the air compressor discharge line and the hydraulic brake line. The owner was notified on May 15, 2013.

13V-179

Triumph Motorcycles America, Ltd. is recalling certain model year 2012-2013 Explorer and Explorer XC motorcycles. The Gross Vehicle Weight Rating data on the certification Label is incorrect. Thus, the motorcycles fail to comply with the requirements of Part 567, "Certification." The incorrect label could cause the operator to overload the motorcycle which may result in handling issues and/or tire failure, increasing the risk of a crash. Triumph will notify owners and replace the labels with corrected GVWR data, free of charge. The recall began on April 30, 2013. Owners may contact Triumph at 1-678-854-2010 for more information.

13V-180

Heartland Recreational Vehicles is recalling certain model year 2013-2014 Big Country, Bighorn, Elk Ridge, Elk Ridge Express, Landmark, Prowler, Sundance, Sundance XLT, and Silverado fifth wheel and travel trailers manufactured February 13, 2013, through April 16, 2013. If the awning installation sequence was not

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2013

Published June 11, 2013

completely followed, the awning motor may unknowingly become damaged. If motor damage has occurred, it is possible that the awning can unfurl unexpectedly, either while the trailer is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Heartland will notify owners and Dometic staff will replace the affected motors with a design that is not subject to an out-of-sequence installation error. The recall began on May 20, 2013. Owners may contact Heartland Recreational Trailers at 1-888-262-5992 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed. Heartland's recall campaign number is 99-01-11.

13V-181

Spartan will notify owners. Starting in mid-June 2013, dealers will install a replacement bracket or a reinforcement to the existing bracket. Until the remedy is available, owners may have their vehicle inspected at any Spartan service center. All repairs will be performed free of charge. The recall is expected to begin on, or before, May 17, 2013. A loss of steering control may increase the risk of a crash. Spartan will notify owners. Starting in mid-June 2013, dealers will install a replacement bracket or a reinforcement to the existing bracket. Until the remedy is available, owners may have their vehicle inspected at any Spartan service center. All repairs will be performed free of charge. Notices were mailed to owners during May 2013.

13V-182

Autocar, LLC is recalling certain model year 2012-2013 ACX trucks built May 1, 2012, through November 15, 2012. Due to an insufficient weld, the windshield wiper arms of the vehicles may not be held in their proper position. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 104, "Windshield wiping and washing systems." Without properly working windshield wipers, the driver's vision could be hindered by precipitation, increasing the risk of a crash. Autocar will notify owners, and dealers will repair the vehicles free of charge. The recall is expected to begin July 2, 2013. Owners may contact Autocar at 1-765-489-5499. Autocar's recall campaign number is A-1303.

13V-183

Autocar, LLC is recalling certain model year 2005-2013 ACX, WX, and WXL trucks built November 16, 2004, through September 10, 2012. On the affected vehicles, the air brake systems were built without the required air tank drain valve. Therefore, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 121, "Air Brake Systems." Air tanks with valves omitted will not drain if moisture is introduced into the tank, potentially reducing air capacity in the air brake system, which could cause a reduction in brake performance and equipment durability, thus increasing the risk of a crash. Autocar will notify owners, and dealers will repair the vehicles free of charge. The recall is expected to begin on July 2, 2013. Owners may contact Autocar at 1-765-489-5499. Autocar's recall campaign number is A-1302.

13V-184

Temsa Global is recalling certain model year 2011-2013 model year TS35C coach buses manufactured from November 2010, through February 2013. Due to a production process error, the fuel tank may develop a leak. A fuel leak in the presence of an ignition source may result in a fire. Temsa will notify owners, and dealers will repair the vehicles free of charge. The recall is expected to begin during June 2013. Owners may contact Temsa Global at 1-404-602-0151.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2013

Published June 11, 2013

13V-185

Heartland Recreational Vehicles (Heartland) is recalling certain model year 2013-2014 Sundance travel trailers, model 322RES, manufactured September 13, 2012, through April 30, 2013. The axles are mounted too far forward on the frame which may cause improper trailer balance while towing. Improper trailer balance may lead to uncontrollable trailer sway, increasing the risk of a crash, property damage, and/or personal injury. Heartland will notify owners and the trailers will be returned to the factory where axles will be moved rearward, free of charge. The recall began on May 20, 2013. Owners may contact Heartland Recreational Trailers' Warranty/Service Department by email at "parts@heartlandrvs.com," or by phone at 1-877-262-8032. Heartland's recall campaign number is 99-01-12.

13V-186

Kovatch Mobile Equipment Corp. (Kovatch) is recalling certain model year 2009-2013 Predator, Predator SS, Panther; 2010-2011 ARFF; and model year 2010-2013 Panther II emergency vehicles. The grease fitting in the steering column shaft may get caught in the column cover. The grease fitting could tear the cover which will impact the driver's ability to steer the vehicle. A sudden loss of steering control may increase the risk of a crash. Kovatch will notify owners and dealers will remove the grease fitting, free of charge. The safety recall began on May 20, 2013. Owners may contact Kovatch at 1-570-669-5173. Kovatch's recall campaign number is 2013-E01.

13V-187

Magic Tilt Trailers is recalling certain boat trailers manufactured October 17, 2011, through January 24, 2012. These trailers are equipped with brake actuators manufactured by Carlisle. On some of the pumps, one of the rotating components in the hydraulic pump for the brakes may have missed a heat treat operation causing the actuator to wear at a higher than normal rate. As a result, the hydraulic pump could fail and result in a loss of braking ability in the trailer. Loss of braking ability can lead to loss of control of the trailer, increasing the risk of a crash, serious injuries, or property damage. Magic Tilt Trailers will notify owners, and dealers will replace the actuators on the trailers, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Magic Tilt Trailers at 1-800-998-8458.

13V-188

Fleetwood RV, Inc. is recalling certain model year 2013 Jamboree Sport Diesel, Providence, Tioga DSL and Tioga Ranger DSL; 2014 Excursion, Expedition, Jamboree Sport, Montara Commercial, Searcher Commercial, Southwind, Storm, Terra, and Tioga Ranger; and 2013-2014 Bounder, Bounder Classic, and Discovery recreational vehicles. The vehicles are equipped with Weatherpro and 9100 series power awnings. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Fleetwood RV will notify owners and Dometic staff will replace the affected motors with a design that is not subject to an out-of-sequence installation error. Fleetwood RV has not yet provided a notification schedule. Owners may contact Fleetwood RV Owner Relations at 1-800-509-3418 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2013

Published June 11, 2013

13V-189

New Heights LLC (New Heights) is recalling certain Equipter RB4000 dump trailers manufactured December 8, 2011, through December 21, 2011. These vehicles are equipped with Carlisle hydraulic brake actuators. One of the rotating components in the hydraulic pump for the brakes missed a heat treat operation causing the actuator to wear at a higher than normal rate. As a result, the hydraulic pump could fail and result in a loss of braking ability in the trailer. Loss of braking ability can lead to loss of control of the trailer, increasing the risk of a crash, serious injuries, or property damage. New Heights will notify owners, and dealers will replace the hydraulic pump actuators free of charge. Owners may contact New Heights at 1-717-768-0070.

13V-191

Elgin Sweeper Company Inc. (Elgin) is recalling certain model year 2006-2012 Crosswind J Alternative Fuel street sweepers, serial numbers J3285, J3260D, J3261D, J3300D, J3367, J3368D, J3370D, J3385D, J3424D, J3426D, J3453D, J3472D, and J3513D. Extended use of the auxiliary hydraulic pump may cause it to overheat and fail. If the auxiliary pump is operated for an extended period of time, the unit could overheat and melt wiring, possibly resulting in a fire. Elgin will notify owners, and dealers will test the electrical draw on the system. If the system is within parameters then the pump solenoid will be replaced, if not, then the complete pump and solenoid will be replaced. The recall began during May 2013. Customers may contact Vactor Customer Service by calling 1-877-342-5374. Elgin's recall campaign number is SB-0116.

13V-192

Altec is recalling certain model year 2010-2011 AC35/38 cranes equipped with 31-55 foot telescopic jibs built between 2010 and 2011. The jib attachment bracket is not sufficient for loads that can occur when the fully extended jib is lifted off the ground. If the jib fails while the crane is in operation, it could pose a risk of injury to people in close proximity. Altec will notify owners and dealers will install jib bracket reinforcement kits. Dealers will also install a kit to repair any jib bracket that is damaged. The manufacturer has not yet provided a notification schedule. Owners may contact Altec at 1-877-462-5832. Altec's recall campaign number is CSN 576.

13V-193

Subaru is recalling certain model year 2013 Outback and Legacy vehicles manufactured from February 15, 2012, through June 15, 2012. In the affected vehicles, the inner and outer shafts of the steering column assembly may become disengaged from one another. If the shafts become disengaged, the driver would lose the ability to steer the vehicle, increasing the risk of a crash. Subaru will notify owners, and dealers will replace the steering column assembly with a new one, free of charge. The recall began on May 14, 2013. Owners may contact Subaru at 1-800-782-2783. Subaru's recall campaign number is WQI-45.

13V-194

Mack Trucks, Inc. is recalling certain model year 2013-2014 CHU, CXU, GU, MRU, and LEU trucks manufactured July 16, 2012, through March 18, 2013 and equipped with drum brakes. The clevis pin for the brake slack adjuster may be missing a cotter pin. If the cotter pin is not installed, the clevis pin may loosen and fall out causing a loss of brake function on the affected wheel. A loss of brake function at one wheel will lead to

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2013

Published June 11, 2013

increased stopping distances and pulling to the left or right when braking, which may increase the risk of a crash. Mack Trucks, Inc. will notify owners, and dealers will inspect the brake slack adjusters and install the brake hardware, as necessary, free of charge. The recall is expected to begin on, or before, June 17, 2013. Owners may contact Mack Trucks at 1-800-528-6586. Mack Trucks' recall campaign number is SC0370.

13V-195

Maserati North America, Inc. (Maserati) is recalling certain model year 2005-2008 Quattroporte, 2008 Granturismo, and 2008 Alfa Romeo 8C vehicles. The rear tie rod assemblies may have insufficient anti-corrosion material applied, allowing them to weaken and possibly fail. Failure of the tie rods may result in a loss of vehicle control and increase the risk of a crash. Maserati will notify owners and dealers will replace the tie rod assemblies. The recall is expected to begin by the end of June 2013. Customers may contact Maserati at 1-877-696-2737. Maserati's recall campaign number is 205.

13V-196

Gulf Stream Coach is recalling certain model year 2001 Ultra, Conquest, Independence, Ultra Supreme, Yellowstone, and Cavalier motorhomes with floorplans 6316 or 8325. The motorhomes were manufactured May 17, 2000, through December 31, 2000. A portion of the electrical wiring may not be properly secured. This condition may cause wear and possible heat development between the refrigerator coils and the wire. A failure of the wiring could result in property damage, fire, or injury. Gulf Stream will notify owners, and dealers will repair the motorhomes free of charge. The recall is expected to begin during June 2013. Owners may contact Gulf Stream at 1-800-289-8787. Gulf Stream's recall campaign number is 13WG-2000.

13V-197

Gulf Stream Coach, Inc. is recalling certain model year 2013 Canyon Trail, Sedona, Ridgeline, Kingsport, and Trail Master recreational vehicle trailers manufactured February 13, 2013, through April 24, 2013. The vehicles are equipped with Weatherpro and 9100 series power awnings. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Gulf Stream will notify owners and Dometic staff will replace the affected motors with motors of a different design. Gulf Stream has not yet provided a notification schedule. Owners may contact Gulf Stream at 1-574-773-7761 or Dometic at 1-888-447-0003 for more information. Gulf Stream Coach's recall number for this campaign is 13AW-0204. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-198

Starcraft Bus is recalling certain model year 2006-2012 Allstar buses manufactured November 2006, through July 2012. The affected buses are equipped with a Ricon manufactured wheelchair lift which may have an optional armored pendant cable. The cable may have been installed such that it doesn't clear the wheelchair lift and without a protective cover, or a misinstalled protective cover. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Starcraft will notify owners and direct them to contact Ricon. Ricon will provide a supplemental cover kit with instructions, free of charge. The recall is

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING MAY 2013

Published June 11, 2013

expected to begin during June 2013. Owners may contact Starcraft at 1-800-348-7440 or Ricon at 1-818-267-3000. Starcraft's recall campaign number is 12E-017.

13V-199

Blue Bird is recalling certain model year 2010 through 2014 All American and Vision model school buses manufactured from August 25, 2009, through March 19, 2013, and equipped with C. E. White Inc. Flip Seats models Quasi Static "QSJ11" (30", 36", 39" and 45"), Student Safety Seat "SSSJ" (30", 36", 39" and 45"), or School Bus Seat "SBJ" (30", 36", 39" and 45"). When a Flip Seat is installed in front of another passenger seat, it is possible for the occupant of the rearward passenger seat to insert their toes and/or foot into the lower frame area of the Flip Seat. When a vehicle passenger occupies the Flip Seat, pushing the seat bottom downward to the horizontal position to sit in the seat, the occupant of the rearward seat could suffer a pinch point injury to their toes and/or foot. feet in the opening on the back of the subject Flip Seats, free of charge. The recall is expected to begin on, or about, June 13, 2013. Owners may contact Blue Bird at 1-478-822-2242 for more information. Blue Bird's number for this campaign is R13WF.

13V-200

Terex is recalling certain model year 2012-2013 Aerial Devices and Digger Derricks manufactured September 2012 through February 2013. The lock valve cavity in the outrigger cylinder may be machined incorrectly and the seals may be damaged. Damaged seals may allow the outrigger to drift. If the outrigger cylinder drifts, stability may be affected and the unit may overturn, increasing the risk of injury. Terex will notify owners, and dealers will inspect the affected outriggers to determine if they were machined correctly. The inspection and any necessary repairs will be performed free of charge. The recall began on May 30, 2013. Owners may contact Terex at 1-605-884-3892. Terex's recall campaign number is SN607.

13V-201

General Motors (GM) is recalling certain model year 2013 Cadillac SRX vehicles, manufactured January 31, 2012, through March 18, 2013, and equipped with 18 inch wheels. On the affected vehicles, the wheel lug nuts may loosen. If the lug nuts loosen, they may fall off or cause the wheel studs to fracture. Either condition would allow the wheel to separate from the vehicle, increasing the risk of a crash. GM will notify owners, and dealers will remove and reinstall the wheel nuts by performing a tire rotation, free of charge. The recall began on June 3, 2013. Owners may contact GM at 1-800-521-7300. GM's recall campaign number is 13116.

13V-202

Forest River is recalling certain model year 2013-2014 Forest River models Blue Ridge, Cardinal, Cherokee, Columbus, EVO, Georgetown, Flagstaff, Forester, Lexington, Puma, Rockwood, Sabre, Salem, Sandpiper, Sandstorm, Sierra, Stealth, Sunseeker, Wildcat, Wildwood, Work and Play and XLR; Coachmen models Brookstone, Catalina, Chaparral, Concord, Encounter, Freedom Express, Frelander, Leprechaun, Mirada, Pursuit, and Sportcoach; Prime Time models Avenger, Crusader, Lacrosse, Saniber, and Tracer; Palomino model Maverick Truck Camper; Cargo Mate model Eliminator and Shasta models Revere, Phoenix recreational vehicles manufactured from February 13, 2013, through April 18, 2013. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit,

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2013

Published June 11, 2013

increasing the risk of personal injury or a vehicle crash. Forest River will notify owners and Dometic staff will replace the affected motors with motors of a different design. A notification schedule has not yet been provided. Owners may contact Forest River at 1-574-389-4600 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-203

John Evans Manufacturing Co. (John Evans) is recalling certain model year 2013-2014 chassis and trailers; model year 2013-2014 remanufactured chassis and trailers, and model year 2013-2014 Cheetah Chassis and trailers. The affected products were manufactured September 5, 2012, through April 19, 2013. The wheel lug nuts may not be properly torqued. Insufficient torque on the wheel lug nuts could lead to separation of the wheels from the chassis or trailer, which may increase the risk of a crash. John Evans will notify owners, and dealers will inspect each trailer. The affected trailers will have the lug nuts re-torqued, free of charge. The recall began on May 30, 2013. Owners may contact John Evans customer service at 1-803-436-3102.

13V-204

Ferrara Fire Apparatus, Inc. (Ferrara) is recalling certain model year 2011-2012 Igniter and Ultra firetrucks. These vehicles are equipped with Meritor axle assemblies that were built with disc brakes using MGM J24 series air brake chambers. In the affected axles, the brake chambers may leak pressure allowing the parking brake to drag when it is supposed to be released. Brake dragging could lead to overheated brake components. Overheated brake components could result in a fire. Ferrara has notified all affected owners and has replaced all of the affected brake chambers. Owners may contact Ferrara at 1-800-443-9006.

13V-205

Isuzu Manufacturing Services of America, Inc. (Isuzu) is recalling certain model year 2013 N-Series trucks manufactured March 8, 2012, through April 26, 2012 and equipped with an automatic transmission. Due to a manufacturing change, the transmission retaining ring may dislodge from the clutch drum. If the ring dislodges while the vehicle is in motion, the vehicle may lose forward driving power and become stalled, increasing the risk of a crash. Isuzu will notify owners, and dealers will replace the affected transmissions, free of charge. The recall is expected to begin during June 2013. Customers may contact Isuzu Customer Service at 1-866-441-9638.

13V-206

Brammo, Inc. is recalling certain model year 2013 Empulse electric motorcycles manufactured February 22, 2013, through March 29, 2013. Due to a high current cable being attached to the motor controller incorrectly, electrical shorting can occur. An electrical short can cause a complete loss of power while riding the motorcycle or a fire, either of which can result in a vehicle crash or personal injury. Brammo will notify owners, and technicians will inspect the high current cable at the motor controller and correct its installation, if needed. The manufacturer has not yet provided a notification schedule. Customers may contact Brammo at 1-541-482-9555.

13V-208

Elite Trailer Manufacturing is recalling certain model year 2012 Livestock Gooseneck trailers manufactured

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING MAY 2013

Published June 11, 2013

November 17, 2011, through January 17, 2012. These vehicles are equipped with Carlisle hydraulic brake actuators. One of the rotating components in the hydraulic brake pump missed a heat treating operation causing the actuator to wear at a higher than normal rate. As a result, the hydraulic pump could fail and result in a loss of braking ability in the trailer. Loss of braking ability can lead to loss of control of the trailer, increasing the risk of a crash, serious injuries, or property damage. Elite Trailer has notified all affected owners and dealers have replaced all of the defective actuators. Owners may contact Elite Trailer at 1-800-657-7305.

13V-209

Triumph Motorcycles (Triumph) is recalling certain model year 2012-2013 Speed Triple motorcycles manufactured June 2012 through January 2013. Due to the incorrect engagement of the neutral switch and gear selector drum, the neutral light may remain illuminated despite the motorcycle actually being in gear. The operator may think the motorcycle is in neutral while the motorcycle is in gear. This could lead to unintended movement of the motorcycle and a possible crash. Triumph will notify owners, and dealers will correct the engagement of the neutral switch and gear selector drum, free of charge. The recall is expected to begin early June 2013. Owners may contact Triumph at 1-678-854-2010 for more information.

13V-211

Triumph Motorcycles (Triumph) is recalling certain model year 2012-2013 Speed Triple ABS motorcycles manufactured June 2012, through January 2013. The transmission on some motorcycles may have been built with an incorrect detent spring. As a result of the incorrect spring, the transmission may inadvertently shift out of gear while the motorcycle is moving, increasing the risk of a crash. Triumph will notify owners, and dealers will install a revised detent spring, free of charge. The recall is expected to begin in June 2013. Owners may contact Triumph at 1-678-854-2010 for more information.

13V-212

Road Rescue is recalling certain ambulances built on model year 2008 Dodge Sprinter 2500 chassis from April 2008 through December 2008. The failure of a power disconnect solenoid terminates the flow of electricity to the ambulance conversion. When the electrical power is interrupted, the siren, warning lights, and patient compartment lights may not operate. There may be a loss of power to life saving equipment in the patient compartment. In the event of an emergency, the ambulance may not be able to alert other vehicles of its presence, slowing its trip to the hospital and increasing the risk of a crash. Wheeled Coach Industries, Inc. will notify owners, and a Wheeled Coach/Road Rescue service center will replace the defective solenoid, free of charge. The recall began on May 31, 2013. Owners may contact Road Rescue at 1-800-628-8178.

13V-213

Pierce Manufacturing Inc. (Pierce) is recalling certain model year 2007-2013 Velocity, Impel, and Dash CF emergency vehicles manufactured June 6, 2007, through May 17, 2013. The springs in the outer door handles are not of sufficient stiffness to prevent inadvertent door opening in certain impacts. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 206, "Door Locks and Door Retention Components." In the event of a crash, the weak springs may allow the door to open and possibly fail to contain emergency personnel or equipment, increasing the risk of injury. Pierce will notify owners, and dealers will replace the door handle spring with a stiffer one, free of charge. Owners may contact Pierce at 1-920-832-

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING MAY 2013

Published June 11, 2013

3000. The manufacturer has not yet provided a notification schedule. Pierce's recall number is 74B242.

13V-214

Triumph Motorcycles (Triumph) is recalling certain model year 2012 Street Triple motorcycles manufactured from June 2012 through November 2012; and model year 2012 Daytona 675 motorcycles manufactured July 2012 through October 2012. The motorcycles may have been assembled without a guide for the throttle cables.

Without the guide, the cables may move freely and become trapped in the steering stop, impeding the steering operation and affecting the driver's ability to control the motorcycle, increasing the risk of a crash. Triumph will notify owners, and dealers will install a throttle cable guide free of charge. The recall is expected to begin during June 2013. Owners may contact Triumph at 1-678-854-2010 for more information.

13V-215

Lotus Cars will notify the owners instructing them to take their vehicle to a Lotus dealer. The federal compliance label will be replaced and an exemption label will be applied, free of charge. The recall began on May 28, 2013.

Owners may contact Lotus at 1-770-476-6564. Lotus Cars' recall number is 2013/02R. An incorrect certification label may prevent the owner from determining recall applicability, potentially increasing the risk of a crash or injury. Lotus Cars will notify the owners instructing them to take their vehicle to a Lotus dealer. The federal compliance label will be replaced and an exemption label will be applied, free of charge. The recall is expected to by the beginning of June 2013. Owners may contact Lotus at 1-770-476-6564. Lotus Cars' recall number is 2013/02R.

13V-216

Fleetwood RV is recalling certain model year 2014 American Revolution, Bounder, Discovery, Expedition, and Southwind motorhomes. Fasteners that attach the solar panel may become loose during normal use. A loose solar panel may separate from the vehicle during travel. This may cause personal injury and/or a road hazard to other vehicles, increasing the risk of a crash. Fleetwood will notify owners, and dealers will install new locking nuts to secure the solar panel, free of charge. The recall is expected to begin in early June 2013. Owners may contact Fleetwood RV at 1-800-322-8216. Fleetwood's recall number is 130517FRV.

13V-217

Fleetwood RV is recalling certain model year 2013 Bounder Classic and Terra motorhomes manufactured between July 9, 2012 and January 16, 2013. The tire load index letter printed on the Federal Certification Tag is incorrect. Due to the inaccurate label, these vehicles fail to comply with the requirements of Part 567, "Certification." The vehicle may be inadvertently fitted with incorrect replacement tires, which could lead tire failure, increasing the risk of a crash. Fleetwood will mail the corrected tags to dealers and owners. Owners who are not comfortable installing these labels may get them installed at a dealer, free of charge. The recall is expected to begin in June 2013. Owners may contact Fleetwood Owner Relations at 1-800-509-3418. Fleetwood's recall number is 130417FRV.

13V-218

General Motors LLC (GM) is recalling certain model year 2013 Cadillac ATS and model year 2013 Cadillac XTS; and model year 2014 Chevrolet Impala vehicles. On the affected vehicles, the brake lamps may

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2013

Published June 11, 2013

intermittently flash without the brakes being applied and the cruise control may disengage. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, reflective devices, and associated equipment." If the brake lamps flash when the vehicle is not slowing, a following driver may not adjust vehicle speed when the vehicle is in fact braking, and the brake lamps are illuminating as intended, increasing the risk of a crash. GM will notify owners, and dealers will reprogram the body control module. The recall is expected to begin June 7, 2013. Owner's may contact Chevrolet at 1-800-630-2438 or Cadillac at 1-866-982-2339. GM's recall number is 13158.

13V-220

New Flyer Industries is recalling certain model year 2012 XD35 and XD40, model year 2013 XD60, XDE40 and XDE60 and model year 2012-2013 XN40 and XN60 transit buses. In the affected buses, the push-to-start button switch may have a weak return spring, allowing the engine to start unexpectedly. If the engine starts without warning, there is an increased risk for injury to persons working on or near the engine. New Flyer will notify owners, and dealers will inspect and replace the switches free of charge. The recall is expected to begin in June 2013. Owners may contact New Flyer customer service at 1-204-224-6706. New Flyer's recall number is R13-014.

13V-221

PACCAR is recalling certain model year 2014 Kenworth T170, T270, T370, T470, T660, T680, T800, T880, and W900 trucks manufactured May 6, 2013, through May 17, 2013; and model year 2014 Peterbilt 330, 337, 348, 365, 367, 382, 384, 386, 388, 389, 389K, 567, 579 and 587 trucks manufactured May 1, 2013 through May 17, 2013. An internal defect in the ignition switch causes the starter to engage when a key is partially inserted, before the key is turned. Unintended engine startup could cause injury to a person working in the engine compartment. Vehicles with standard transmissions may experience unexpected movement, which may result in personal injury or a crash. PACCAR will notify owners, and dealers will replace affected ignition switches, free of charge. The recall began by June 2013. Owners may contact Kenworth at 1-425-828-5000 or Peterbilt at 1-940-591-4000. Kenworth's recall campaign number is 13KWF. Peterbilt's recall campaign number is 0513-E.

13V-222

Triumph Motorcycles Ltd, (Triumph) is recalling certain model year 2012-2013 Trophy and Trophy SE motorcycles manufactured September 2012 through March 2013. The two layers used in the construction of the fuel tank may have failed to adhere, which may result in a fuel leak. If the fuel tank leaks, the unexpected fuel loss may lead to an engine stall while riding, increasing the risk of a crash. A fuel leak in the presence of an ignition source may also result in a fire. Triumph will notify owners, and dealers will replace the fuel tank. The recall is expected to begin during June 2013. Owners may contact Triumph customer service at 1-888-283-5288.

13V-223

Altec Industries, Inc. is recalling certain model year 2010-2012 AT200A, AT235/235P, AT237, AT248F, AT35/37-G, and AT40-G aerial devices built on Ford F550 chassis with a gross vehicle weight rating of 19,500lbs. The battery cable going to the unit auxiliary functions could be damaged and possibly short to

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2013

Published June 11, 2013

ground. If the battery cable shorts to ground, it may overheat, resulting in a fire. Altec began notifying affected owners on April 24, 2013. Dealers will re-route the auxiliary function battery cables. Owners may contact Altec at 1-800-860-0183. Altec's recall number is CSN 565.

13V-224

General Motors LLC (GM) and IMPCO Automotive Division of IMPCO Technologies, Inc. (IMPCO) are recalling certain model year 2011-2013 Chevrolet Express and GMC Savana Cargo vans that have a compressed natural gas (CNG) fuel system installed as original equipment by IMPCO. The fuel systems, manufactured February 14, 2011, through February 20, 2013, have a fuel shut-off solenoid connector to the CNG tank that may corrode and form a short. A short at the connector may cause overheating, resulting in an increased risk of fire. GM will notify owners and GM dealers/fleets will perform the remedy which will include replacing the solenoid assemblies and fuel pump fuses and adjusting the wiring routing. An owner notification schedule has not yet been provided. GM's number for this recall is 13139. Impco's number for this recall is FA13GM001. Owner's may contact GM Fleet Action Center at 1-800-353-3867.

13V-225

Blue Bird is recalling certain 2014 model year Blue Bird conventional (Vision) model school buses manufactured from March 11, 2013 through April 29, 2013 and equipped with Ford propane engines. On the subject buses, the brake light switches may not have been adjusted properly. Misadjusted brake light switches may result in one of the following occurrences: the brake lights may remain illuminated after the brake pedal has been released; the brake lights may be delayed in illumination after the brake pedal has been depressed. Either condition may increase the risk of a crash. Blue Bird will notify owners, and dealers will inspect the adjustment of the brake light switch. Any brake light switch found not properly adjusted will be replaced. This work will be performed free of charge. The recall is expected to begin on, or about, June 28, 2013. Owners may contact Blue Bird at 1-478-822-2242. Blue Bird's number for this recall is R13WG.

13V-226

Ford is recalling certain model year 2013 Explorer, Taurus, Flex, Fusion, Police Interceptor Sedan and Police Interceptor Utility vehicles; and certain model year 2013 Lincoln MKS, MKT, and MKZ vehicles. In the affected vehicles, the fuel delivery module may develop a crack, allowing fuel to leak. A fuel leak in the presence of an ignition source may result in a fire. Ford will notify owners, and dealers will replace the fuel delivery module, free of charge. The recall is expected to begin on July 15, 2013. Owners may contact Ford Motor Company Customer Relationship Center at 1-866-436-7332. Ford's recall campaign number is 13S04.

13V-227

Aston Martin is recalling certain model year DB9, Virage, V8 Vantage, V12 Vantage, and Rapide vehicles manufactured from May 14, 2012, through April 10, 2013. Due to a manufacturing error, the throttle pedal arm may break. If the throttle pedal arm breaks, the engine will return to idle and the driver will be unable to maintain or increase engine speed, increasing the risk of a crash. Aston Martin will notify owners, and dealers will replace the throttle pedal assemblies. The manufacturer has not yet provided a notification schedule. Owners may contact Aston Martin customer service by calling 1-888-923-9988. Aston Martin's recall number is RA-03-

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2013

Published June 11, 2013

0016.

13V-228

CODA Automotive (CODA) is recalling certain model year 2012 CODA vehicles. The side curtain airbags may have been improperly rolled during production which could cause the airbag to not deploy as intended. In the event of a crash necessitating side curtain airbag deployment, the side curtain airbags may fail to deploy as intended, increasing the risk of injury. This recall supersedes a previous recall conducted by CODA, 12V-409. All owners, including owners involved in the previous campaign, will be notified and instructed to go to CODA dealers to have both side curtain airbags replaced free of charge. The safety recall is expected to begin on, or about, June 11, 2013. Owners should contact their dealer for more information. CODA Automotive's recall campaign number is R84002.

13V-229

Ford is recalling certain model year 2013 Lincoln MKZ vehicles manufactured April 25, 2012, through March 15, 2013 and equipped with an engine block heater. During use, the engine block heater cords may be bent and in certain temperatures, the wire insulation may crack, exposing the electrical wires. Exposed electrical wires increase the risk of electric shock. Ford will notify owners, and dealers will replace the block heater cord, free of charge. The recall is expected to begin June 17, 2013. Ford's recall number is 13S05. Owners may contact the Ford customer relationship center at 1-866-436-7332.

13V-230

Ford is recalling certain model year 2013 Fusion vehicles manufactured April 19, 2013, through April 23, 2013. The steering gears may be missing an internal retaining clip. If the clip is missing, components inside the steering gear may become dislodged inside the gear assembly. This could result in impaired steering, including the loss of steering control, increasing the risk of a crash. Ford will notify owners, and dealers will replace the steering gear, free of charge. The recall is expected to begin in mid-June 2013. Ford's recall number is 13S06. Owners may contact the Ford customer relationship center at 1-866-436-7332.

13V-232