

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING JULY 2013

Published August 13, 2013

CHILD SEATS:

None during July 2013.

EQUIPMENT:

Thermo King Corporation (Thermo King) is recalling certain Precedent S-600 transportation refrigeration units manufactured April 15, 2013, through May 15, 2013. The lifting bracket that is used to install and remove the unit may break. If the lifting bracket breaks during installation or removal of the refrigeration unit, the unit may fall increasing the risk of injury. Thermo King will notify owners and dealers will re-weld the lifting brackets free of charge. The recall began on July 29, 2013. Owners may contact Thermo King at 1-866-776-2708.

13E-036

Kuryakyn Holdings, LLC (Kuryakyn) is recalling certain model number 7437 handlebar risers/setbacks sold for use on Honda Goldwing GL1800s. The screws used in mounting the handlebar risers may break after installation. If the screws break, the handlebars may separate from the motorcycle, making it difficult for the operator to control the motorcycle, increasing the risk of a crash. Kuryakyn will notify customers and send them replacement screws and instruct them to visit their nearest motorcycle dealer to have the replacement screws installed. The service will be done at no cost to the owner. The recall is expected to begin during August 2013. Owners may contact Kuryakyn at 1-866-296-4728.

13E-037

Nissin Kogyo Co., LTD is recalling certain motorcycle antilock braking system (ABS) modulators, part number NK2R3, manufactured June 18, 2012, through March 22, 2013. Due to aluminum filings remaining inside the modulators from the manufacturing process, ABS functionality may be lost. A loss of ABS operation may result in the motorcycle wheels locking up during hard braking increasing the risk of a crash. Nissin has contacted all of the motorcycle manufacturers involved with this recall and the motorcycle manufacturers will be contacting the affected customers to have the ABS units replaced free of charge. Owners with questions should contact their motorcycle manufacturer. If owners have additional questions, they may contact Nissin representation at 1-614-227-2117.

13E-038

Fastec Industrial Corp. (FIC) is recalling certain model 43610, 40610, and 44610 door locks manufactured between January 2006 and April 2013 with a keyed paddle handle and deadbolt for use in recreational vehicles. It may be possible to remove the key from the lock in a way that potentially jams the deadbolt in locks with certain key codes. If the deadbolt jams, the interior side of the door lock may also jam. A person inside the recreational vehicle at the time will then be locked in and be unable to exit the vehicle without using the emergency exit, increasing the risk of injury. FIC will notify the original equipment door and recreational vehicle manufacturers and the consumers of record and instruct them on how to determine whether they have a defective lock. Consumers of record will be sent replacement cylinders with instructions, free of charge. The vehicle manufacturers will notify their consumers. The recall is expected to begin September 10, 2013. Owners may contact FIC at 1-800-837-2505.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2013

Published August 13, 2013

13E-039

American Honda Motor Co. is recalling certain Trailer Hitch Harness Kits, Part Number 08L91-TZ5-200. These kits are for use in 2014 model year Acura MDX vehicles. The trailer hitch kit has a subharness that is incorrectly wired such that there may be no power supplied to an accessory trailer brake controller. If the trailer brake controller is not powered, when towing a trailer, longer stopping distances could be required, increasing the risk of a crash. Honda will notify owners and Acura dealers will correct the trailer hitch subharness wiring, free of charge. The recall is expected to begin on August 23, 2013. Owners may contact Acura Customer Service at 1-800-382-2238. Honda's number for this campaign is JB2.

13E-040

Cequent Performance Products is recalling certain Tekonsha Electric Trailer Brake Control Wiring Adapters with Part No. 30232-P and 30231-P. These adapters are used as aftermarket equipment on model year 2013 Dodge Ram 1500 vehicles. If the brakes are applied while the turn signal is activated, the turn signal may turn off. The opposite trailer turn signal may then activate. An incorrect turn signal will not properly notify others of the driver's intent (such as direction of a turn or lane change), increasing the risk of a crash. Cequent will notify distributors, dealers, installers, and customers and will replace the adapters free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Cequent at 1-877-827-0799.

13E-041

TIRES:

Michelin Tire is recalling certain Latitude Tour P255/70 R18 (DOT TIN B9YU99CX and DOT date range 1313 through 2113) and P255/60 R19 108 S (DOT TIN B9R1W3WX and DOT date range 1913 through 2113), X Radial LT2 P265/65 R18 112 T (DOT TIN B9KA003X and DOT date range 0513 through 2113) and P275/55 R20 111 T (DOT TIN B99Y001X and DOT date range 0513 through 2113), LTX M/S2 RBL P275/55 R20 111 T (DOT TIN B99Y56EX and DOT date range 3812 through 2113), LTX M/S2 ORWL P265/60 R18 109 T (DOT TIN B95E788X and DOT date range 1513 through 2113), and LTX M/S2 tires P265/65 R18 112 T (DOT TIN B9XP001X and DOT date range 0513 through 2113). Due to a perforation in the sidewall, the tires may lose pressure while driving. A loss of tire air pressure may lead to sudden tire failure, increasing the risk of a crash. Michelin will notify owners, and dealers will inspect and replace any affected tires free of charge. The recall began on July 22, 2013. Owners may contact Michelin Consumer Care at 1-855-851-4951.

13T-006

Beijing Capital Tyre Co. (BCT) is recalling certain Autoguard LT245/75R16 tires manufactured June 25th, 2012, through November 11th, 2012. These tires failed the endurance test standards of FMVSS 139 and contain incorrect maximum load data on the sidewall. Thus, these tires fail to comply to the requirements of Federal Motor Vehicle Safety Standard No. 139, "New Pneumatic Radial Tires for Light Vehicles." During use, the tires may crack in the tread area leading to sudden air loss, and tire failure. Additionally, owners may unknowingly overload the tires which may lead to tire failure. Either condition increases the risk of a crash. Beijing Capital Tyre will notify owners and dealers will replace the tires, free of charge. The manufacturer has

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2013

Published August 13, 2013

not yet provided a notification schedule. Owners may contact Tire Group International, Inc., BCT's U.S. contact, at 1-305-696-0096 extension 5538.

13T-007

VEHICLES:

Chrysler is recalling certain model year 2011-2013 Sebring and 200 vehicles manufactured June 28, 2011, through December 13, 2012; model year 2011-2013 Dodge Avenger vehicles manufactured June 25, 2011, through January 14, 2013; model year 2011-2012 Dodge Nitro vehicles manufactured June 17, 2011, through December 15, 2011; and model year 2011-2012 Jeep Liberty vehicles manufactured June 17, 2011, through August 15, 2012. Electrical over-stress of a resistor in the occupant restraint control module may lead to the non-deployment of the active head restraints during a rear impact collision. In the event of a crash necessitating the deployment of the active head restraints, their non-deployment could increase the risk of injury. Chrysler will notify owners, and dealers will flash the Totally Integrated Power Module (TIPM) or replace the occupant restraint control module, as needed, free of charge. The recall is expected to begin in August 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N38.

13V-282

Chrysler is recalling certain model year 2013 Town & Country, Dodge Grand Caravan, and RAM C/V Tradesman vehicles manufactured May 10, 2012, through June 7, 2013. A software error may result in the opposite side airbags deploying from the collision point (a left side impact would deploy the right side airbags and vice versa). In the event of a crash, the wrong side airbags could deploy leaving the occupant with no airbag protection at the point of impact, increasing the risk of injury. Chrysler will notify owners, and dealers will flash the occupant restraint control module, free of charge. The recall is expected to begin in August 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N44.

13V-283

Monaco RV, LLC (Monaco) is recalling certain model year 2011 Holiday Rambler Campmaster and R-Vision Trail Cruiser; model year 2011-2012 R-Vision Onyx; model year 2011-2013 R-Vision Trail Light; model year 2012-2014 Holiday Rambler Aluma-Lite, Aluma-Lite Ultra and R-Vision Trail Sport and Trail-Lite Crossover; and model year 2013-2014 McKenzie Rainier Ascent and R-Vision Trail Lite Trek recreational vehicles. These vehicles were manufactured October 12, 2009, through March 15, 2013 and have the water tanks mounted under the floor within enclosed underbellies. The water tank mounting system may fail. If the mounting system fails, the water tank may separate from the vehicle and become a road hazard, increasing the risk of a crash. Monaco RV, LLC will notify owners and dealers will install a cross brace between the water tank and the mounting brackets, free of charge. The recall is expected to begin during August 2013. Monaco's recall number is 13001MRV. Owners may contact Monaco at 1-877-466-6226.

13V-284

Augusta RV, LLC is recalling certain model year 2013-2014 FLEX recreational trailers manufactured February 13, 2013, through April 9, 2013. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2013

Published August 13, 2013

unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Augusta RV will notify owners during August 2013 and Dometic staff will replace the affected motors with motors of a different design. Owners may contact Augusta RV at 1-574-848-0200 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-285

Kibbi, LLC is recalling one model year 2013 Renegade KIT28TA trailer manufactured on April 12, 2013. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Kibbi will notify the owner and Dometic staff will replace the affected motor with one of a different design. The recall began during July 2013. Owners may contact Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-286

Chrysler is recalling certain model year 2013 RAM 1500 4x4 trucks manufactured June 26, 2012, through February 5, 2013. Due to a software issue with the Electronic Stability Control (ESC) module, the ESC system may be disabled when the vehicle is started. A disabled ESC system may result in loss of directional control, increasing the risk of a crash. Chrysler will notify owners, and dealers will update the ESC module software, free of charge. The recall is expected to begin in August 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N37. Chrysler will notify owners, and dealers will update the ESC module software, free of charge. The recall is expected to begin in August 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N37.

13V-287

Chrysler is recalling certain model year 2013 RAM 4500 and 5500 trucks manufactured January 22, 2013, through March 8, 2013. An incorrect bolt may have been used to attach the track bar to the frame. The incorrect attaching bolt may break or fall out, resulting in the vehicle suddenly pulling to one side, increasing the risk of a crash. Chrysler will notify owners, and dealers will inspect and replace the track bar fasteners, as necessary, free of charge. The recall is expected to begin in August 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N41.

13V-288

Chrysler is recalling certain model year 2014, non-SRT trimmed, Grand Cherokee vehicles manufactured January 14, 2013, through March 20, 2013 equipped with premium headlamps. In the affected vehicles, when switching between daytime running lights and parking lights, electrical spikes may cause the parking lamps to turn off. Without properly functioning parking lamps these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 108, "Lamps, reflective devices, and associated equipment." Without parking lamps, the vehicle may not be as visible to other vehicles, increasing the risk of a crash. Chrysler will notify owners, and dealers will update the Central Body Controller software, free of charge. The recall is expected to begin in August 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2013

Published August 13, 2013

campaign number is N42.

13V-289

Farber Specialty Vehicles (Farber) is recalling certain 2012 Ford 550 Command Center vehicles. Due to a design change in the Dometic-brand power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Farber will notify owners and Dometic staff will replace the affected motors with motors of a different design. The recall began on July 22, 2013. Owners may contact Farber at 1-800-331-3188 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-290

Chrysler is recalling certain model year 2013 Town & Country and Dodge Grand Caravan vehicles manufactured June 11, 2013, through June 12, 2013. The occupant restraint control module (ORC) has incorrect software installed which may adversely affect air bag deployments in collisions. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 208, "Occupant Crash Protection" and No. 214, "Side Impact Protection." An air bag that does not deploy, or deploys improperly, may increase the risk of injury. Chrysler will notify owners, and dealers will replace the ORC module, free of charge. The recall is expected to begin in August 2013. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is N48.

13V-291

Toyota is recalling certain model year 2012 Yaris vehicles manufactured August 21, 2011, through August 31, 2011. A relay in the Power Steering Control Module of the electronic power steering system could experience a short circuit due to insufficient distance between terminals in the relay and moisture contamination of relay coil windings. A short circuit in the relay could disable power steering assistance. If the power steering assistance shuts off, the driver may have difficulty steering the vehicle at low speeds, increasing the risk of a crash. Toyota will notify owners, and dealers will replace the power steering control module. The recall began on July 31, 2013. Owners may contact Toyota at 1-800-331-4331.

13V-292

Dutchmen Manufacturing, Inc. is recalling certain model year 2013-2014 Aspen 1400RB, 1500BH, 1600RB, 2110RBS, 2470BHS and 3010BHDS travel trailers; certain model year 2013-2014 Coleman CTS14FD, CTS15BH, CTS16BH and CTS16QB travel trailers and certain model year 2013-2014 Dutchmen 190QB, 282RBS, 286BHGS, 318RKDS and 816QB travel trailers. Heat from the range burner may melt the propane supply hose. If the hose melts it may leak propane, increasing the risk of a fire. Dutchmen will notify owners and dealers will install a copper line to the propane connection in the burner, free of charge. The recall began on August 7, 2013. Owners may contact Dutchmen at 1-574-537-0600. Dutchmen's recall number is 13-195.

13V-293

Transportation Collaborative, Inc. (TCI) is recalling one model year 2010 TransTech DW6159RLSST and one

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2013

Published August 13, 2013

model year 2012 TransTech SC159DSFP600 school buses equipped with a Ricon wheelchair lift with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. TCI will notify owners and Ricon will send owners a supplemental cover kit and installation instructions free of charge. This recall campaign began on July 22, 2013. Owners may contact Ricon Customer Service at 1-800-322-2884 or by e-mail at recall.admin@wabtec.com.

13V-294

EverGreen Recreational Vehicles, LLC (EverGreen) is recalling certain model year 2013 Bay Hill fifth wheel travel trailers manufactured March 13, 2013, through April 25, 2013. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. EverGreen will notify owners and Dometic staff will replace the affected motors with motors of a different design. The recall began on July 25, 2013. Owners may contact Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-295

Ameritrans Bus, Inc. is recalling one model year 2013 M2-Series bus equipped with a Ricon wheelchair lift with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Ameritrans will notify the owner and Ricon will send the owner a supplemental cover kit and instructions free of charge. The recall began during July 2013. More information can be obtained by contacting Ricon Customer Service at 1-800-322-2884 or by e-mail at recall.admin@wabtec.com.

13V-296

American Honda Motor Co., Inc. (Honda) is recalling certain model year 2013 Accord vehicles that are Low-Emission Vehicle (LEV) II rated that were manufactured January 15, 2013, through April 5, 2013. The fuel tank neck may be out of specification causing the fuel pump to not properly seal to the fuel tank. An insufficient seal may lead to a fuel leak which increases the risk of a fire. Honda will notify owners, and dealers will replace the fuel tank, nut and O-ring gasket free of charge. The recall is expected to begin during August 2013. Honda's recall number is JA9. Owners may contact Honda at 1-310-783-2000.

13V-297

Yamaha Motor Company (Yamaha) is recalling certain model year 2014 XVS950CU (Bolt) motorcycles manufactured March 2013 through June 2013. Slack or sag in the wiring harness may allow it to contact the exhaust manifold causing the wires to melt, and possibly short circuit. If the wires short circuit, the fuses will blow which may cause the engine to stall. An engine stall while riding, increases the risk of a crash. Yamaha will notify owners, and dealers will inspect the wiring harness and secure it away from the exhaust. If the wiring harness is damaged, it will first be replaced. The recall is during August 2013. Owners may contact Yamaha at

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2013

Published August 13, 2013

1-800-962-7926.

13V-298

TMC Group, Inc. is recalling certain model year 2006-2013 Ameritrans E-Series buses manufactured August 1, 2006, through July 31, 2012. These buses are equipped with a Ricon wheelchair lift with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Ricon will send owners a supplemental cover kit and instructions free of charge. A notice to owners was mailed by certified mail on July 5, 2013. Owners may contact Ricon Customer Service at 1-800-322-2884 or by e-mail at recall.admin@wabtec.com.

13V-299

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2013 Outlander Sport vehicles manufactured January 17, 2013, through January 25, 2013. The stabilizer link bracket on the left front strut was improperly welded. As a result, the link may detach and cause damage to the tire and/or brake hose. If the stabilizer link bracket damages the tire and/or brake line, the driver may have more difficulty controlling the steering of the vehicle, or the vehicle may require a longer stopping distance to come to a complete and controlled stop. Either condition increases the risk of a crash. MMNA will notify owners, and dealers will inspect, and if necessary, replace the front left strut assembly free of charge. The recall began on July 30, 2013. Owners may contact MMNA at 1-888-648-7820. MMNA's recall number is SR-13-008.

13V-300

Lakota Corp (Lakota) is recalling certain model year 2014 CX9-BBX18 (Charger and Bighorn) recreational trailers. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If motor damage occurs, it is possible that the awning can unfurl unexpectedly, either while the motorhome is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Lakota will notify owners and Dometic staff will replace the affected motors with motors of a different design. The manufacturer has not yet provided a notification schedule. Owners may contact Lakota Corp at 1-574-848-1636 or Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-301

Spartan Motors Chassis, Inc. (Spartan Chassis) is recalling certain model year 2011-2013 Transit Bus Chassis Cabs manufactured February 17, 2011, through February 14, 2013. Due to an improper connection in the extension harness that connects the main chassis harness to the fuel pump, the fuel pump may inadvertently shut off. If the fuel pump shuts off, the engine will stall without warning, increasing the risk of a crash. Spartan Motors will notify owners and dealers will install a new extension harness, free of charge. The recall is expected to begin in early August 2013. Owners may contact Spartan Motors at 1-517-543-6400. This is Spartan campaign number 13015.

13V-302

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2013

Published August 13, 2013

Ford Motor Company is recalling certain model year 2013 C-Max hybrid vehicles, without panoramic roofs, that were manufactured January 19, 2012, through June 25, 2013. During vehicle testing, the vehicle exceeded a head injury criteria requirement set by the standard. Thus, these vehicles fail to conform to Federal Motor Vehicle Safety Standard No. 201, "Occupant Protection in Interior Impact." In the event of a crash, an occupant could be at an increased risk of an injury. Ford will notify owners, and dealers will install energy absorbers between the headliner and the roof. The recall is expected to begin August 19, 2013. Owners may contact the Ford customer relationship center at 1-866-436-7332. Ford's recall number is 13C02.

13V-303

Temsa Global is recalling certain model year 2007-2013 TS35C and model year 2012-2013 TS30 coach buses. The label indicating the nearest emergency exit window release mechanism may be missing. Thus, these buses fail to conform with Federal Motor Vehicle Safety Standard No. 217, "Bus Emergency Exits and Window Retention and Release." Without a label to identify the closest release mechanism, in the case of an emergency, passengers may spend extra time to find the location of an exit window release mechanism, increasing the risk of injury. Temsa Global will notify owners and have any missing labels installed. The manufacturer has not yet provided a notification schedule. Owners may contact CH Bus Sales at 1-407-271-8935.

13V-304

Keystone RV is recalling certain model year 2013-2014 Laredo Fifth Wheel vehicles, models 270SRL, 280SBH, 290SRE and 293SBH, manufactured March 6, 2013, through June 27, 2013. The battery box has inadequate support for the battery and the box may fall out of position during travel. The battery box may fall out of position resulting in electrical shorts which may lead to a fire. Also, the battery box may fall from the vehicle creating a road hazard. Keystone RV will notify owners and will install a battery box mounting reinforcement kit, free of charge. The recall began on July 22, 2013. Owners may contact Keystone Customer Service by calling 1-866-425-4369. Keystone's identification code for this recall is 13-194.

13V-305

Matthews Specialty Vehicles is recalling one model year 2013 Freightliner XCR bus manufactured June 27, 2013; and one model year 2000 Thomas Built FE bus manufactured April 15, 2013; and model year 2013 International TerraStar buses manufactured June 12, 2013; and one model year 2011 Thomas Built CHSU/Mickey bus manufactured April 24, 2013. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Matthews Specialty Vehicles will notify the owner and Dometic staff will replace the affected motor with one of a different design. The recall began on August 13, 2013. Owners may contact Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-306

Honda is recalling certain model year 2014 CTX700 motorcycles manufactured March 6, 2013, through April 11, 2013. Due to a manufacturing error, the Anti-Lock Brake System (ABS) may malfunction and lose anti-lock functionality. The anti-lock function may not perform properly allowing for wheel lock up and skidding,

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING JULY 2013

Published August 13, 2013

increasing the risk of a crash. Honda will notify owners and dealers will replace the ABS modulator, free of charge. Owners may contact Honda at 1-800-999-1009. Honda's recall number is JB0.

13V-307

Glaval Bus is recalling certain model year 2010-2013 Universal, Concorde II, Entourage, Primetime, Titan II, Apollo, and Sport buses, certain model year 2011-2013 Titan II If and Legacy buses and certain model year 2010 Synergy buses. The affected buses are equipped with a rear interior air conditioner evaporator which may come loose from its ceiling mounting over time. The evaporator unit may detach from the ceiling and fall increasing the risk of injury. Glaval will notify owners, and dealers will tighten and replace the air conditioner evaporator mounting bolts, as needed, free of charge. The recall is expected to begin in early August 2013. Owners may contact Glaval at 1-800-445-2825 or glavalcustomerservice@forestriverinc.com.

13V-309

Kawasaki Motors Corp. is recalling certain model year 2013 EX300BDFAL motorcycles manufactured August 16, 2012, through April 2, 2013. Due to a manufacturing error, the Anti-Lock Brake System (ABS) may malfunction and lose anti-lock functionality. The anti-lock function may not perform properly allowing for wheel lock up and skidding, increasing the risk of a crash. Kawasaki will notify owners and dealers will replace the affected ABS pumps with a new assembly. The recall began on August 5, 2013. Owners may contact Kawasaki at 1-866-802-9381.

13V-310

HL Enterprise Inc. is recalling certain model year 2013 Hyline HY42IKEB and HY44, model year 2013 Georgian Bay GB39CKT, model year 2013 Bridgeview BV42IKWT, and model year 2013 Premier FW44 and HY42 trailers. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. HL Enterprise Inc. will notify owners and Dometic staff will replace the affected motors with one of a different design. The recall is expected to begin during August. Owners may contact Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-311

Suzuki Motor Corporation (Suzuki) is recalling certain model year 2013 GSX1300RA Hayabusa motorcycles manufactured January 22, 2013, through April 26, 2013. Due to a manufacturing error, the Anti-Lock Brake System (ABS) may malfunction and lose anti-lock functionality. The anti-lock function may not perform properly allowing for wheel lock up and skidding, increasing the risk of a crash. Suzuki will notify owners, and dealers will replace the affected ABS units, free of charge. The recall began on August 5, 2013. Owners may contact Suzuki at 1-800-255-2550. Suzuki's campaign number for this recall is WN.

13V-312

Morgan 3 Wheeler Limited (Morgan) is recalling certain model year 2012-2013 three-wheeled motorcycles manufactured between October 2012 and July 2013. The brake fluid reservoir does not have a brake fluid

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING JULY 2013

Published August 13, 2013

reservoir filling warning statement. Thus, these vehicles fail to conform to the requirement of Federal Motor Vehicle Safety Standard (FMVSS) No. 122, "Motorcycle Brake Systems." The operator may not be warned of the brake fluid reservoir filling requirements, which may result in a reduction of brake performance, increasing the risk of a crash. Morgan will notify owners and dealers will apply a brake fluid reservoir filling warning label, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Morgan's US Agent at 1-505-570-1845.

13V-313

Lotus Cars USA, Inc. is recalling certain model year 2011 Evora supercharged vehicles equipped with a manual transmission and manufactured September 2010 through September 2011. The engine oil cooler hose may chafe and rupture resulting in oil loss. Engine oil may be ejected onto the road or rear wheels which could cause a reduction in vehicle control and potential engine failure, increasing the risk of a crash. Engine oil sprayed onto a heat source may also lead to a vehicle fire. The remedy for this recall campaign is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact Lotus at 1-770-476-6564. Lotus' campaign number is 2013/03R.

13V-314

General Motors is recalling certain model year 2014 Chevrolet Silverado trucks manufactured June 1, 2013, through June 30, 2013; and model year 2014 GMC Sierra trucks manufactured June 4, 2013, through June 30, 2013. Welding on the passenger airbag inflator may fracture when the airbag is deployed, allowing some gas from the air bag inflator to vent behind the instrument panel, instead of into the air bag. As a result the air bag may not fully inflate, increasing the risk of injury. General Motors will notify owners and dealers will replace the passenger air bag module, free of charge. The recall is expected to begin during August 2013. Owners may contact Chevrolet at 1-866-694-6546 and GMC at 1-866-996-9463. GM's recall number is 13230.

13V-315

Spartan Motors, Inc. is recalling certain model year 2012-2013 Utilimaster Reach vehicles. A software problem in the control module may cause the vehicle to have an inadvertent engine shutdown. An engine shutdown without warning increases the risk of a crash. Spartan will notify owners, and dealers will replace the control modules free of charge. The recall began August 9, 2013. Owners may contact Spartan Motors at 1-800-582-3454.

13V-316

Temsa Global is recalling certain model year 2013 TS30 buses manufactured in April 2013. Due to an improper heat treatment, the axle shafts may break. If the axles break while driving, the bus could become stuck in traffic, increasing the risk of a crash. Temsa will notify owners and dealers will replace the axle shafts. The manufacturer has not yet provided a notification schedule. Owners may contact Temsa at 1-877-858-3672.

13V-317

Winnebago Industries is recalling certain model year 2011 Vista and Itasca Sunstar motorhomes manufactured June 30, 2010, through June 16, 2011. The vehicles have an incorrect tire inflation pressures and wheel rim sizes on the Vehicle Certification Label. Thus, these vehicles fail to comply with the requirements of the Code of

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2013

Published August 13, 2013

Federal Regulations, Part 567, "Certification." Incorrect tire pressures or tire size may lead to a tire failure, which could result in a loss of vehicle control increasing the risk of a crash. Winnebago will notify owners and mail corrected Vehicle Certification Labels to the owners, free of charge. The recall is expected to begin by mid-August 2013. Owners may contact Winnebago at 1-800-537-1885 or or@winnebagoind.com. Winnebago's campaign number is 129.

13V-318

Triumph Motorcycles is recalling certain model year 2012-2013 Street Triple and Street Triple R motorcycles manufactured in July 2012; and model year 2012-2013 Daytona 675 and Daytona 675 R motorcycles manufactured September 2012 through June 2013. Due to a manufacturing error, the Anti-Lock Brake System (ABS) may malfunction and lose anti-lock functionality. The anti-lock function may not perform properly allowing for wheel lock up and skidding, increasing the risk of a crash. Triumph will notify owners and dealers will replace the ABS modulator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Triumph at 1-888-283-5288.

13V-319

Navistar is recalling certain model year 2006 through 2009, and 2012 IC CE school buses and certain model year 2006 through 2009, and 2011 through 2013 IC RE school buses manufactured from October 6, 2005, through April 18, 2012, and equipped with C. E. White Inc. brand flip seats. When a flip seat is installed in front of another passenger seat, it is possible for the occupant of the rearward passenger seat to insert their toes and/or foot into the lower frame area of the flip seat. When a vehicle passenger occupies the flip seat, pushing the seat bottom downward to the horizontal position to sit in the seat, the occupant of the rearward seat could suffer a pinch point injury to their toes and/or foot. Navistar will notify owners, and dealers will install a safety guard to prevent passengers from placing their toes or feet in the opening on the back of the subject Flip Seats, free of charge. The recall is expected to begin on, or about, September 17, 2013. Owners may contact Navistar 1-800-448-7825 for more information. Navistar's number for this recall is 13511.

13V-320

Compass Conversions is recalling one model year 2007 Bloomer Horse Trailer and one model year 2003 Elite Horse Trailer. Due to a design change in the power awning motor assembly, the motor assembly screws may unknowingly shear. If the motor assembly screws shear, it is possible that the awning can unfurl unexpectedly, either while the vehicle is at rest or while in transit, increasing the risk of personal injury or a vehicle crash. Compass Conversions will notify owners and Dometic staff will replace the affected motors with one of a different design. The recall is expected to begin in August 2013. Owners may contact Dometic at 1-888-447-0003 for more information. Owners are being instructed not to drive their vehicle until repairs can be performed.

13V-321

PACCAR Inc. is recalling certain model year 2010-2012 Kenworth T4 and W9 series vehicles manufactured November 13, 2009, through August 26, 2011. The alternator wiring may come in contact with the exhaust manifold. If the alternator wiring comes in contact with the exhaust manifold, the wiring may melt and lead to a vehicle fire. PACCAR will notify owners and dealers will re-route the alternator wiring, free of charge. The recall is expected to begin in late August. Owners may contact PACCAR at 1-425-468-7400. Kenworth's

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2013

Published August 13, 2013

recall number is 13KWJ.

13V-322

Piaggio Group Americas (Piaggio) is recalling certain model year 2012-2013 Moto Guzzi Stelvio NTX 1200 motorcycles manufactured February 6, 2012, through April 10, 2013; and model year 2012-2013 Moto Guzzi Norge 1200 motorcycles manufactured January 25, 2012, through March 21, 2013; and model year 2012-2013 Moto Guzzi Griso 1200 motorcycles manufactured January 26, 2012, through April 29, 2013. Due to a manufacturing fault, the rear suspension connecting links could fracture. If the rear suspension links fail while riding, the rear suspension would suddenly collapse, increasing the risk of a crash. Piaggio will notify owners, and Moto Guzzi dealers will replace the rear suspension connecting links on the affected vehicles, free of charge. The recall is expected to begin in August 2013. Owners may contact Piaggio at 1-877-696-6864.

13V-323

Nissan is recalling certain model year 2014 Versa Note vehicles manufactured April 23, 2013, through July 3, 2013. The lower body sill bolts may be missing or incorrectly torqued. Missing lower body bolts may affect the vehicle's integrity in the event of a rear impact, increasing the risk of injury. Nissan will notify owners, and dealers will install and tighten to specification the lower body sill bolts, as needed, free of charge. The recall is expected to begin August 19, 2013. Owners may contact Nissan at 1-800-647-7261.

13V-324

Daimler Buses North Carolina LLC (Daimler) is recalling certain model year 2007-2009 Sprinter Mini-buses equipped with a Ricon wheelchair lift with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Daimler will notify owners and Ricon will send the owner a supplemental cover kit and instructions free of charge. The recall began on August 6, 2013. More information can be obtained by contacting Ricon Customer Service at 1-800-322-2884 or by e-mail at recall.admin@wabtec.com.

13V-325

Nissan is recalling certain model year 2014 Versa Note vehicles manufactured April 23, 2013, through July 5, 2013. The rear seat latch bolts may have been manufactured incorrectly, reducing their strength. If the rear seat latch bolts break, the rear seats may not perform as designed in a crash, increasing the risk of injury to back seat occupants. Nissan will notify owners, and dealers will replace the rear seat latch bolts, free of charge. The recall is expected to begin August 19, 2013. Owners may contact Nissan at 1-800-647-7261.

13V-326

Setra Luxury Coaches is recalling certain model year 2013 S417TC buses manufactured in April and May 2013. The bolted joint at the lower control arm in the rear axle could loosen due to a change in the manufacturing tightening method. If the control arm loosens, it could reduce the driver's ability to control the direction of the vehicle, increasing the risk of a crash. Motor Coach Industries (MCI), the designated importer, will notify

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2013

Published August 13, 2013

customers and will retorque the bolted connection. This service will be completed at no cost to the customer. The recall is expected to begin by the middle of September 2013. Owners may contact MCI at 1-866-624-2622. Setra's campaign number is 32.00U08919A.

13V-327

Kawasaki Motors Corp. is recalling certain model year 2013 Ninja 300 and 300 ABS motorcycles manufactured July 16, 2012, through April 27, 2013. Due to an improper setting in the Electronic Control Unit (ECU), the motorcycle may stall under deceleration. A stall under deceleration increases the risk of a crash. Kawasaki will notify owners, and dealers will replace the ECU. The recall began on August 5, 2013. Owners may contact Kawasaki at 1-866-802-9381.

13V-328

Zero Motorcycles is recalling certain model year 2011 and 2012 S and DS motorcycles. On the affected motorcycles, the front caliper mounting bolts are susceptible to corrosion which could lead to their cracking and possible fracture. If a front caliper bolt fractures, the caliper may come loose and interfere with the rotation of the front wheel. This could cause the front wheel to stop suddenly, increasing the risk of a crash. Zero Motorcycles will notify owners, and dealers will replace the front caliper bolts. The recall is expected to begin mid-August 2013. Owners may contact Zero Motorcycles at 1-888-841-8085.

13V-329

Entegra Coach is recalling certain model year 2013-2014 Anthem, Aspire, and Cornerstone motorhomes manufactured February 8, 2013, through June 13, 2013. The attachment mechanism that holds the windshield wiper arm to the wiper motor shaft could crack. If the attachment mechanism cracks, the windshield wiper may separate reducing the driver's visibility, increasing the risk of a crash. Entegra Coach will notify owners, and dealers will replace the wiper arms, at no charge. The recall is expected to begin in late August 2013. Owners may contact Entegra Coach at 1-800-945-4787.

13V-330

Jayco is recalling certain model year 2014 Precept Motorhomes manufactured March 28, 2013, through June 27, 2013. The attachment mechanism that holds the windshield wiper arm to the wiper motor shaft could crack. If the attachment mechanism cracks, the windshield wiper may detach reducing the driver's visibility, increasing the risk of a crash. Jayco will notify owners, and dealers will replace the wiper arm, at no charge. The recall is expected to begin in late August 2013. Owners may contact Jayco at 1-800-283-8267.

13V-331

Blue Bird Body Company is recalling certain model year 2007-2014 All American and Vision school buses manufactured March 10, 2006, through June 18, 2013; and equipped with optional transit sliding windows. Joint adhesive may not have been applied at the interior and exterior body window panel joints. Without the adhesive, these vehicles fail to conform to the standards of Federal Motor Vehicle Safety Standard (FMVSS) No. 221, "School Bus Body Joint Strength." In the event of a vehicle crash, there is an increased risk that the window panels may separate and fall onto occupants causing injury. Blue Bird will notify owners, and dealers will install additional rivets at the window panel joints, free of charge. The recall is expected to begin by August

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING JULY 2013**

Published August 13, 2013

30, 2013. Owners may contact Blue Bird at 1-478-825-2021. Blue Bird's recall number is R13WM.

13V-332